

M/700 Customer Complaint

NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700
 GENERAL CONDITION: NEW R #: 016257
 OUTSIDE WORK: NO DATE: 8-16-72
 FIRED AMMO TYPE: _____ FROM: HENRY L. FRAME
 & CONDITION: _____ W. BARRINGTON, R.I.
 PROOF: R.E.P. INSP.: 1A TEST: 49 GUN #: 297377
 HEADING: _____ CODE: WR = 8/68
 BREACH OPENING: _____ GK./CAL.: 270 WIN.
 RECOIL SHOULDERS: O.K. CHECKED BY: C. PROSSER
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

TRIGGER PULL 3 1/2 LBS. SEAR-TRIGGER CONNECTOR
 ENGAGEMENT .005 (MIN. 15.020) STICKY LUBRICANT
 INSIDE HOUSING, CORNER OF TRIGGER CONNECTOR
 WORN ROUND.

COMPLAINT: "IT DISCHARGES PREMATURELY"

INCIDENT: FOLLOW DOWN

COMMENTS: WITH INSUFFICIENT ENGAGEMENT BETWEEN
 SEAR & CONNECTOR THE CONNECTOR BROKE DOWN
 ON THE CORNER ALLOWING THE FOLLOW DOWN
 MALFUNCTION.

PLAINTIFF'S
EXHIBIT

3216

AL 0029746