

M/76 Customer Complaint

1. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700GENERAL CONDITION: Good R #: 014720OUTSIDE WORK: SCOPE MOUNTED, BUTT PLATE DATE: 7-24-72CHANGED TO RECOIL PAD. FROM: S.R. MAYMOULFIRED AMMO TYPE: - MELBOURN, FLA.& CONDITION: _____ GUN #: 357864PROOF: R.E.P. INSP.: 0 TEST: A7 CODE: RP = 11/67HEADING: O.K. G.K./CAL.: 300GBREECH OPENING: - CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K. APPROVED: _____CHAMBER: O.K. APPROVED: _____TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

TRIGGER ADJUSTING SCREWS NOT SEALED (NO INDICATION
THE EVER WERE). ENGAGEMENT SEAR TO TRIGGER CONNECTOR
.020, TRIGGER PULL ALBS, TRIGGER RUBS ON GUARD.
GREASE LIKE LUBRICANT ON TRIGGER INSIDE HOUSING.

COMPLAINT: FIRES WHEN THE SAFETY IS THROWN OFF.INCIDENT: FOLLOW DOWN

COMMENTS: THE HEAVY LUBRICANT COMBINED WITH FRICTION
OF THE TRIGGER AGAINST THE TRIGGER GUARD
CAUSED TRIGGER RETRACTION TO BE ERRATIC
RESULTING IN FOLLOW DOWN.

PLAINTIFF'S
EXHIBIT

3219

AL 0029751