

N/710 Cust. Complaint

... No GUN REGISTRATION REPORT NUMBER: _____ MODEL: 700 BDL
 GENERAL CONDITION: Good R #: 014609
 OUTSIDE WORK: SCREWS MONITOR DATE: 7-21-72
 FROM: LEO D. JONES
 FIRED AMMO TYPE: 150 GR. SUPER X HARREN, OHIO
 & CONDITION: _____ GUN #: 6282457
 PROOF: R.E.P.-D INCH.: 7.9 TEST: Q7 CODE: ES-10/69
 READING: O.K. ME./OAL.: 7MM REM MAG
 BREACH OPENING: _____ CHECKED BY: C. PROSSER
 RECOIL SHOULDER: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: _____ APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

SCREW-TRIGGER CONNECTOR ENGAGEMENT .005 (MIN. IS .020)
STEP IN FACE OF BOLT. TRIGGER NOT DB-BURNED.

COMPLAINT: "UPON OPENING THE BOLT THE GUN DISCHARGED.
"SHUTS HARD TO CHAMBER"

INCIDENT: FOLLOW DOWN, CLOSURE HARD

COMMENTS: FOLLOW DOWN WAS CAUSED BY .005 ENGAGEMENT
AND SLIGHT TRIGGER BIND. THE CLOSURE HARD WAS DUE
TO THE STEP IN THE BOLT FACE WHICH CREATED A MIN.
HEADER CONDITION NOT PICKED UP BY THE HEADING
DUMMY.

PLAINTIFF'S
EXHIBIT

3221

AL 0029753