

V1700 Custom Comp. 1/1

I. NO GUN EXAMINATION REPORT NUMBER: _____MODEL: 700 VARMINTGENERAL CONDITION: NEWR #: 014137OUTSIDE WORK: FRONT TRIGGER ADJUSTINGDATE: 7-13-72SCREWS ADJUSTED.FROM: H.L. PETERS INC.

FIRED AMMO TYPE: _____

BUFFALO, N.Y.

& CONDITION: _____

GUN #: 6519891PROOF: R.E.P.-M INSP.: 48 TEST: 44LW = 2/72
CODE: PW = 6/72HEADING: -GA./CAL.: 25-06 REM.BREECH OPENING: -CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K.

APPROVED: _____

CHAMBER: O.K.

APPROVED: _____

TEST: NO

APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style)

APPROVED: _____

CONNECTOR - SEAR ENGAGEMENT .010 (MIN. = .020) TRIGGER
ADJUSTING SCREW BACKED OUT ELIMINATING SPRING TENSION
REQUIRED TO RETRACT TRIGGER & TRIGGER CONNECTOR.

COMPLAINT: FIRES WHEN CLOSING BOLTINCIDENT: FOLLOW DOWNCOMMENTS: APPARENTLY THE CUSTOMER ATTEMPTING TO

ADJUST THE TRIGGER PULL, BACKED THE ADJUSTING
SCREW OUT TOO FAR WHICH ELIMINATED ALL SPRING
TENSION. WITHOUT THIS, THE TRIGGER AND CONNECTOR
FAILED TO RETRACT RESULTING IN FOLLOW DOWN.

PLAINTIFF'S
EXHIBIT

3223

AL 0029755