

1. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDL
 GENERAL CONDITION: NEW R #: 013324
 OUTSIDE WORK: NO DATE: 7-6-72
 FIRED AMMO TYPE: _____ FROM: MEYER HOWER ^{INC.} SPAS,
 & CONDITION: _____ GOLDEN, COLO.
 PROOF: R.E.P. ASSEMBLER R10 GUN #: 6230255
 INSP.: 73 TEST: 87 CODE: AS = 3/69
 HEADING: _____ GA./CAL.: 6MM REM.
 BREACH OPENING: - CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

CONNECTOR CLEARANCE ON TRIGGER .004 UNDER MIN. DUE
PIN TO TOP OF TRIGGER ON MAY. TRIGGER HITS TRIGGER
HOUSING. HEAVY LUBRICANT USED INSIDE HOUSING.
SAFETY R. .001 UNDER MIN. CONNECTOR CLEARANCE .005 D.
WITH SAFETY ON.

COMPLAINT: "HAMMER FALLS"

INCIDENT: FOLLOW DOWN

COMMENTS: THE COMBINATION OF LOW SAFETY, HIGH TRIGGER
AND TRIGGER BIND CAUSES FAILURE TO RETRACT WHEN
TRIGGER IS PULLED WITH SAFETY ON, THEN FOLLOW
DOWN WHEN SAFETY IS PUSHED OFF.



AL 0029757