

M/700 Customer Complaint.

NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700
GENERAL CONDITION: NEW R #: 012758
OUTSIDE WORK: FRONT ADJUSTING SCREWS DATE: 6-12-72
UNSEALED FROM: J.V. ELIOT JR.
FIRED AMMO TYPE: _____ SAN MEOTO, CALIF.
& CONDITION: _____ GUN #: 6446926
PROOF: R.E.P.-L INSP.: ASSEM. 30 TEST: 84 CODE: DU= 9/71
HEADING: O.K. GAE./CAL.: 17 REM.
BREECH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: EXCESSIVE RADIUS APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

CORNER OF SEAR CHIPPED OFF. FIRING PIN HOLE NOT
ROUNDED. FIRING PIN HOLE, REAR, NOT CLEANED - FIRING
PIN ASSEMBLY RUSTY. ENGAGEMENT UNDER MIN. - SEAR TO
CONNECTOR.

COMPLAINT: FOLLOWS DOWN

INCIDENT: FOLLOW DOWN

COMMENTS: EVIDENTLY THE CUSTOMER EXPERIENCED A PIECED
PRIMER, WHICH WITH UNDER MIN ENGAGEMENT CAUSED
THE CORNER OF THE SEAR TO CHIP OFF.

PLAINTIFF'S
EXHIBIT

3228

AL 0029760