

NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
GENERAL CONDITION: LIKE NEW R #: _____
OUTSIDE WORK: NO DATE: 11-3-70
FIRED AMMO TYPE: _____ FROM: EAU CLAIRE,
_____ WISCONSIN.
& CONDITION: _____ GUN #: 6258555
PROOF: _____ INSP.: _____ TEST: _____ CODE: 03-7/69
HEADING: _____ GA./CAL.: 3006
BREECH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: _____ APPROVED: _____
CHAMBER: _____ APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____
O.K.

PLAINTIFF'S
EXHIBIT

3245

COMPLAINT: GUN FIRES WHEN SAFETY IS PUSHED ON FIRE.INCIDENT: NOT VERIFIED.

COMMENTS: HEAVY LUBRICANT PRESENT. PARTS MEASURED
INDICATE EXCESSIVE CLEARANCE (.013) BETWEEN
TRIGGER & CONNECTOR, WHICH WOULD ALLOW THE CONNECTOR
TO MOVE UP & INTERFERE WITH THE FRONT
OF THE SEAR AND PREVENT RETRACTION.
SEAR-CONNECTOR ENGAGEMENT .010.

1 of 1