

1. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDL
 GENERAL CONDITION: NEW R #: 002023
 OUTSIDE WORK: NO DATE: 1-27-72
 FIRED AMMO TYPE: _____ FROM: BAY CITY HDQ. CO.
 & CONDITION: _____ BAY CITY, MICH.
 PROOF: R.E.P.-M INSP.: ASSEMBLER 44 GUN #: 6500965
 TEST: 13 CODE: NONE
 HEADING: O.K. GA./CAL.: 243 WIN.
 BREECH OPENING: - CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

MILINE STOCK, TRIGGER PULL 4 1/2 LBS. - O.K. ENGAGEMENT
.008 (.020 MIN.) NEW RIVETED HOUSING CONNECTOR
1.093 M/D = 1.080 TRIGGER 1.076 M/D = 1.076 BURS ON
CONNECTOR SIDES.

PLAINTIFF'S
EXHIBIT

3261

COMPLAINT: "FIRES ON SAFE"

INCIDENT: MAY HAVE FOLLOWED DOWN WHEN SAFE WAS
RELEASED.

COMMENTS: ENGAGEMENT IS SET TOO CLOSE, WITH THE
BURS ON THE CONNECTOR AND CLOSE ENGAGEMENT,
IT IS POSSIBLE THAT THE CONNECTOR FAILED TO
RETRACT WHILE THE SAFETY WAS ON THEN FOLLOW
DOWN OCCURRED WHEN THE SAFETY WAS RELEASED.

1 of 1