

1-87/10-1 Nov. 2-15-61

Customer Complaint

GUN EXAMINATION REPORT NUMBER: _____ MODEL: 750 S-TL

GENERAL CONDITION: NEW R # : 229700

OUTSIDE WORK: ✓ DATE: 12-9-71

FIRE ARM TYPE: _____ FROM: SAFETY, 1000, 1000

& CONDITION: _____ GUN # : 6810000

PROOF: 2000-5 INSP.: 0 TEST: SM CODE: PT-1/2

HEADING: OK GA./CAL.: 3000

BREACH OPENING: 1 CHECKED BY: 2-10000

RECOIL SHOULDERS: OK APPROVED: _____

CHAMBER: OK APPROVED: _____

TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

NO DAMAGE-BROKEN COMPONENTS.

TRIGGER CONNECTOR CLEARANCE 1.092 (1.075)

CLEARANCE 1.092 (1.075) ENGAGEMENT, 500 IN

TRIGGER PULL OK. SLIGHT COILER BEHIND

SEAR & TRIGGER CONNECTOR CONNECT

COMPLAINT: FIRE WHEN SAFE IS RELEASED.

INCIDENT: FOLLOWS DOWN

PLAINTIFF'S
EXHIBIT

3267

COMMENTS: CUSTOMER'S MALFUNCTION NOT CONFIRMED. IT IS

POSSIBLE WITH COMPONENTS SUBSTITUTED BY THE

TRIGGER CONNECTOR TO WIDE UP ON TRIGGER (CLEAR-

ANCE, 017 OVER MAY), ALSO TRIGGER MAY HAVE BEEN

TRIGGER DUE TO BIND IN THE TRIGGER GUARD CAUSED BY

OUT OF POSITION SCREW HOLES IN THE GUARD.

1 of 1