

P. No GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDLGENERAL CONDITION: NEW R #: 13298OUTSIDE WORK: No DATE: 6-29-71FIRED AMMO TYPE: T FROM: J.C. PENNEY& CONDITION: ASSEMBLED 79 GUN #: 6274124PROOP: R.E.P.-E INSP.: 58 TEST: 13 CODE: DS-9/69HEADING: O.K. GA./CAL.: 270BRESCCH OPENING: _____ CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K. APPROVED: _____CHAMBER: O.K. APPROVED: _____TEST: No APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

No BROKEN OR DAMAGED COMPONENTS.TRIGGER CONNECTED - SEAR ENGAGEMENT .012 (.020 - MIN.)TRIGGER DULL 4 1/2 LBS. - A SMALL METAL CRIP - CAUSEBETWEEN TRIGGER CONNECTOR & STRIKER.COMPLAINT: "FIRES DURING SHELL EXTRACTION"INCIDENT: FOLLOWING DOWNPLAINTIFF'S
EXHIBIT

3272

COMMENTS: THE CUSTOMER'S MALFUNCTION COULD NOT BEDIAGNOSED. THE UNDER MAIN FIRE ARMAMENT WAS EXAMINEDBY THE METAL CRIP (HELD IN PLACE BY A PROTECTIVECORATING APPLIED BY THE CUSTOMER) PROBABLY CAUSEDA MALFUNCTION.

1 of 1