

P. No GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
 GENERAL CONDITION: Good R #: 07367
 OUTSIDE WORK: No DATE: 4-26-71
 FROM: MONTGOMERY WARD
 FIRED AMMO TYPE: _____
 & CONDITION: _____ GUN #: 6204725
 PROOF: REP. INSPECTION: 9 TEST: 41 CODE: XR = 12/68
 HEADING: O.K. GR./CAL.: 270 WIN.
 BREACH OPENING: _____ CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: No. APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

NO DAMAGED OR BROKEN COMPONENTS.

COMPLAINT: "FIRED WHEN BOLT WAS CLOSED."

INCIDENT: _____

PLAINTIFF'S
EXHIBIT

3276

COMMENTS: COULD NOT DUPLICATE CUSTOMER'S MALFUNCTION.
HOWEVER, TRIGGER-CONNECTOR CLEARANCE BEING EXCESS-
IVE & TOO HEAVY LUBRICANT MAY HAVE CONTRIBUTED TO
SUCH A FAILURE IN COLD TEMPERATURES.

CONNECTOR .006 OVERSIZE (1.089)

TRIGGER .009 UNDERSIZE (1.067)

REPLACED TRIGGER & CONNECTOR ENGAGEMENT O.K.

1 of 1