

OK	597	2719888	11-98		INSTALLED OPERATING HANDLE CORRECTLY, INSTALLED NEW STYLE	21047	\$29.58
CAN	597	2921126M	11-98	M10	REPLACED BOLT HANDLE, MAG ASSY, EJECTOR, BOLT HANDLE SPRING, ACTION	21096	\$41.10
OR	597	2721406	11-98	MISSING EXTRACTOR.	REPLACED EXTRACTOR, CLEANED AND TESTED.	20023	\$28.52
LA	597	2722415	11-98	M5, M10	REPLACED EXTRACTOR, PLUNGER, RET SPRING & RIVET.	107416	\$32.92
OR	597	2721837	11-98	FIRED BULGING CASE.	RETURNED TO FACTORY.	20023	\$35.56
MN	597	2727776	12-98	M10	INSTALLED & FIT EXTRACTOR ASSY CORRECTLY, ADJUSTED BOLT HAMMER AND	20017	\$45.70
NY	597	2923803M	12-98	M145	REPLACED BOLT ASSY, SAFETY & FUNCTION CHECKED AND TESTED.	21177	\$20.00
IL	597	2724086	12-98	M24, M31, M33	REPLACED EJECTOR, MAG BOX & HOLD OPEN SPRING, REMOVED BURRS AT	21028	\$41.43
TX	597	2923169M	12-98	M9, M10	REPLACED EXTRACTOR, PLUNGER & SPRING, POLISHED CHAMBER, CLEANED &	21125	\$38.79
CO	597	2923480M	12-98	FAILS TO FIRE.	RETURNED TO FACTORY.	106412	\$15.00
MN	597	2729174	01-99	M23	ADJUSTED LINKAGE ON TRIGGER GROUP TO MOVE FREELY, ADJUSTED CLIP LATCH TO	20017	\$40.45
MN	597	2731859	01-99	M23	REPLACED CLIP, REPAIRED EJECTOR AND TEST FIRED.	20017	\$39.76
CAN	597	2924249M	01-99	RECEIVER CRACKED.	REPLACED RECEIVER, TRANSFERRED	20957	\$102.70
CA	597	2732167	01-99	SCOPE MT RAILS SCRATCHED. POOR FINISH ON RECEIVER, REC	PARTS & TESTED, TOOK OLD RECEIVER TO SENT TO FACTORY.	20801	\$35.00
GA	597	2735921	02-99	JAMS.	INSTALLED NEW STYLE EJECTOR.	20502	\$12.31
NY	597	2927035M	02-99	M145	REPLACED BROKEN BOLT ASSY, SAFETY & FUNCTION CHECKED AND TESTED.	21177	\$20.00
OK	597	2741237	03-99	M9	INSTALLED NEW STYLE EJECTOR, SAFETY & TEST FIRED.	21047	\$34.58
NC	597	2742060	03-99	M5	REPLACED BOLT HANDLE SPRING & RIVET.	21102	\$38.20
VA	597	2748112	04-99	FAILS TO FULLY EXTRACT.	INSTALLED NEW EJECTOR.	21090	\$30.17

Subject to Protective Order - Williams v. Remington

BARBER - REM DOCSB0010246

MAE00010162