| MAE |
|----------|
| 0 |
| 0 |
| 0 |
| \vdash |
| 0 |
| \vdash |
| g |
| Ø |

| | | | \$ | migroconomic to the seconomic to the sec |
|-----|-----|-------------------|--------------------|--|
| MAN | 597 | 29443 92M | 12-99 | M9, M10 |
| ОН | 697 | 29 4534 1M | 12.99 | GUN JAMS. |
| NY | 597 | 2943741M | 112-99 | M993 |
| MN | 597 | 2944392 % | 12-99 | DEFECTIVE MAG |
| IL | 597 | 2778869 | ¹ 01-00 | M24, M31; M33 |
| TX | 597 | 2777906 | 01-00 | M9 |
| AL | 597 | 2777333 | 101-00 | MAG LATCH FELL DUT. |
| MI | 597 | 2777268 | 101-00 | CLIP DOESN'T HOLD. |
| ОН | 597 | 2777240 | 101-00 | CLIP KEEPS FALLING OUT. |
| NY | 597 | 2950482M | 101-00 | M110 |
| NY | 597 | 2782855 | 102-00 | M110, M137 |
| ОН | 597 | 2782270 | 02-00 | WILL NOT EJECT SHELLS. |
| СТ | 597 | 2720413 | 02-00 | M22 |
| СТ | 597 | 2720413 | 02-00 | DEFECTIVE TRIGGER ASSY. |
| NY | 597 | 2730801 | 02-00 | M137 |
| СТ | 597 | 2746205 | 02-00 | M9, M23 |
| ok | 597 | 2951604M | 02-00 | No. of the Control of |
| OK | 597 | 2782034 | 02-00 | M9 |
| WI | 597 | 2783828 | 03-00 | ROUNDS HANG UP, FEEDING PROBLEMS, JAMS. |
| | | | | |

| | DEGREASED EXTRACTOR SPRING & | | |
|---|---|---------------|--------------------|
| | PLUNGER, ADJUSTED EXTRACTOR TO GRAB | 20017 | \$44.76 |
| | INSTALLED EXTRACTOR, SPRING & PLUNGER, CLEANED, CHECKED AND TEST | 21060 | \$49.36 |
| | REASSEMBLED CORRECTLY, SAFETY & | 21000 | \$45.30 |
| | FUNCTION CHECKED AND TESTED. | 21177 | \$20.00 |
| | REPLACED DEFECTIVE MAGAZINE AND TEST | | 4= |
| | FIRED. | 20017 | \$35.63 |
| × | REPLACED EJECTOR, MAG BOX, REMOVED | | |
| | BURRS AT CHAMBER AREA AND TEST FIRED. | 21028 | \$41.86 |
| | REPLACED EJECTOR. | 21123 | \$20.67 |
| | REPLACED EJECTOR. | 21123 | \$20.01 |
| | REPLACED MAG LATCH. | 21056 | \$22.00 |
| | | | , |
| d | REPLACED PIN AND SPRING ASSY IN REC. | 21030 | \$20.00 |
| | REPLACED TRIGGER HOUSING REPLACED | | |
| | NEW STYLE EJECTOR & ADJUSTED, TIGHTENED TRIGGER LINKAGE RIVET. | 21060 | \$0.00 |
| | SAFETY & FUNCTION CHECKED AND | 21177 | \$20.00 |
| | ADJUSTED ACTION TIGHTNESS REPLACED | ~ | 923.00 |
| | EJECTOR, SAFETY & FUNCTION CHECKED | 2117 7 | \$20.00 |
| | GROUND EJECTOR FOR BOLT CLEARANCE, | | |
| | INSTALLED NEW TYPE OF EJECTOR | 21060 | \$53.48 |
| | REPAIRED DING IN STOCK, CHECKED OVER, | 05000 | SEAR OF |
| | CLEANED & OILED, SAFETY & FUNCTION REPLACED DEFECTIVE TRIGGER ASSY. | 20629 | \$41.25 |
| | CHECKED OVER, CLEANED & OILED, SAFETY | 20629 | 574. 79 |
| | REPLACED EJECTOR, ADJUSTED ACTION | | |
| | TIGHTNESS, SAFETY & FUNCTION CHECKED | 21177 | \$20.00 |
| | REPLACED EJECTOR, CLEANED & POLISHED | | |
| | CHAMBER, CHECKED OVER, CLEANED & | 20629 | \$42.98 |
| | REPLACED TRIGGER HOUSING ASSY & LIFTERS, SAFETY & TEST FIRED. | 21047 | \$68.84 |
| | REPLACED TRIGGER HOUSING ASSY. | Z:U4/ | ψUQ.U T |
| | INSTALLED NEW STYLE EJECTOR, SAFETY & | 21047 | \$68.81 |
| | CHECKED OVER ACTION, OILED, TEST | | |
| | FIRED, REPLACED MAGAZINE. | 21024 | \$25.79 |
| | | | |