

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDLGENERAL CONDITION: GOOD R #: 01780OUTSIDE WORK: SCOPE MOUNTED, REAR SIGHT DATE: 1-26-71LEAF REMOVED. FROM: GREEN BROOK, N.J.FIRED AMMO TYPE: _____ GREEN BROOK, N.J.& CONDITION: _____ GUN #: 6362025PROOF: R.E.P.-E INSP.: 74 TEST: 87 CODE: WT = 8/70HEADING: O.K. GRA./CAL.: 7MM MAG.BREACH OPENING: _____ CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K. APPROVED: _____CHAMBER: O.K. APPROVED: _____TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

COMPONENTS O.K.COMPLAINT: "UPON RELEASING THE SAFETY MAY FIRE"INCIDENT: FELL-W DOWNPLAINTIFF'S
EXHIBIT

3282

COMMENTS: THE MALFUNCTION CAN NOT BE DUPLICATED,
HOWEVER, THE SEAR-CONNECTOR ENGAGEMENT IS NOT
TO SPECIFICATION (.008 SHOULD BE .015 MIN.) THIS COUPLED
WITH ANY TRIGGER BIND, SUCH AS TOO HEAVY LUBRICANT,
MIGHT CAUSE A MALFUNCTION. ENGAGEMENT
CORRECTED.

1 of 1

AL 0029814