

Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDL
 GENERAL CONDITION: NEW R #: 27287
 OUTSIDE WORK: NO DATE: 11-23-70
 FIRED AMMO TYPE: _____ FROM: SABOT EREC. CO.
 & CONDITION: _____ VERNAL, UTAH
 PROOF: R.E.P. 2 INSP: 74 TEST: 55 GUN #: 6296977
 HEADING: _____ CODE: LT = 2/70
 BREACH OPENING: _____ GAU/CAL.: 3006
 RECOIL SHOULDERS: _____ CHECKED BY: C. PROSSER
 CHAMBER: _____ APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

TRIGGER / CONNECTOR CLEARANCE .003 OUTSIDE MODEL
 DRAWING. CONNECTOR / TRIGGER CLEARANCE .005 OUTSIDE
 MODEL DRAWING. THIS ADDS UP TO .008 MORE MOVE-
 MENT UP, OF CONNECTOR THAN THERE SHOULD BE TO
 POSSIBLE INTERFERENCE WITH THE SEAR.

COMPLAINT: "TRIGGER FIRES SOMETIMES WHEN TAKEN OFF
 SAFE" (EXTRACTOR FAULTY)

INCIDENT: FOLLOWS DOWN WHEN SAFE IS PUSHED OFF.

COMMENTS: THE FALLING DOWN MALFUNCTION COULD NOT
 BE VERIFIED ALTHOUGH EXCESSIVE CONNECTOR
 MOVEMENT IS PRESENT.

EXTRACTOR CHAIN DAMAGED.

PLAINTIFF'S
 EXHIBIT
 3293

1 of 1