

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 600

GENERAL CONDITION: FAIR R #: 09920

OUTSIDE WORK: ? TRIGGER ASSEMBLY ADJUST- DATE: 4-27-71
MENTS INCORRECT FROM: N. SHORE SGT. GDS.

FIRE AMMO TYPE: _____ RICE LAKE, WIS.

& CONDITION: _____ GUN #: 75441

PROOF: R.E.P. ASSEMBLER ID: _____ CODE: ON = 7/66

INSPECTION: U TEST: 66

HEADING: O.K. GR./CAL.: 308 WIN.

BREECH OPENING: - CHECKED BY: C. PROSSER

RECOIL SHOULDERS: O.K. APPROVED: _____

CHAMBER: O.K. APPROVED: _____

TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

NO DAMAGED, BROKEN COMPONENTS.

SEAR CONNECTOR ENGAGEMENT .0607 (MAY HAVE BEEN CHANGED BY CUSTOMER) DIRT AROUND SEAR AND TRIGGER SPRING.

COMPLAINT: FIRES WHEN SAFETY IS PUSHED OFF. TRIGGER PULLED WITH SAFETY ON.

INCIDENT: FOLLOWS DOWN.

COMMENTS: COULD NOT DUPLICATE CUSTOMER'S MALFUNCTION. HOWEVER, TRIGGER-CONNECTOR DIMENSIONS PLUS DIRT INSIDE HOUSING COULD PERMIT A MALFUNCTION OF THIS TYPE. TRIGGER CLEARANCE ON CONNECTOR .003 OVER MAX. CONNECTOR CLEARANCE ON TRIGGER .002 UNDER MIN. CONNECTOR COULD WORK UP, INTERFERE WITH SEAR AND FAIL TO RETRACT.

FEDERAL BUREAU OF INVESTIGATION

PLAINTIFF'S
EXHIBIT
3324

AL (X)29984