

*Customer Complaint*

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 600

GENERAL CONDITION: GOOD R #: 05361

OUTSIDE WORK: NO DATE: 3-12-71

FIRED AMMO TYPE: \_\_\_\_\_ FROM: OLBON SPTG. GDS.

& CONDITION: \_\_\_\_\_ OTTUMWA, IOWA

PROOF: R.E.P. INSP: U TEST: 49 GUN #: 33903

HEADING: \_\_\_\_\_ CODE: LM\* 2/65

BREACH OPENING: \_\_\_\_\_ GR./CAL.: 350 MAG.

RECOIL SHOULDERS: O.K. CHECKED BY: C. PROSSER

CHAMBER: O.K. APPROVED: \_\_\_\_\_

TEST: NO APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

NO BROKEN, DAMAGED COMPONENTS.

**K S C**

COMPLAINT: MISFIRES, FIRES WHEN GUN IS OPENED.

INCIDENT: FIRING PIN HEAD CATCHES ON HOUSING.

COMMENTS: THE CUSTOMER'S MALFUNCTION WAS NOT DUPLICATED, HOWEVER A MARK LEFT ON THE INSIDE, LEFT REAR CORNER OF THE HOUSING BY THE FIRING PIN HEAD INDICATES AN INTERFERENCE WHICH MIGHT CAUSE SUCH MALFUNCTION. ALSO, SEAR AND SAFETY CAM WERE FOUND TO BE STUCK TOGETHER WITH SOME EXCESSIVELY HEAVY LUBRICANT.

PLAINTIFF'S EXHIBIT 3325

*121*