


660
~~700~~ Customer Complaint

NO GUN EXAMINATION REPORT NUMBER: MODEL: 660
 GENERAL CONDITION: GOOD R #: 018859
 OUTSIDE WORK: NO DATE: 10-3-72
 FIRED AMMO TYPE: FROM: GEO. ORNDUFF
 & CONDITION: NEW MARTINSVILLE, W. VA.
 PROOF: R.E.P. INSP. U TEST: 13 GUN #: 131278
 HEADING: O.K. CODE: AR = 3/68
 BREECH OPENING: - GA./CAL.: 243 WIN.
 RECOIL SHOULDERS: O.K. CHECKED BY: C. PROSSER
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

HOUSING CUT IN RECEIVER OFF CENTER.
 ENGAGEMENT BETWEEN CONNECTOR & SEAR, 0.05 (MIN. IS
 0.20). EXCESSIVE LUBRICANT INSIDE TRIGGER ASSEMBLY.

COMPLAINT: DISCHARGED WHEN SAFETY WAS MOVED FROM
ON TO OFF.

INCIDENT: FOLLOW DOWN

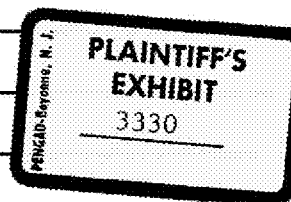

COMMENTS: THE MALFUNCTION MAY HAVE BEEN CAUSED
 BY THE FIRING PIN HERE CATCHING ON THE EXPOSED
 SIDE OF THE HOUSING, INSTEAD OF SEATING ON THE
 SEAR THE RESULTING BURR IN THE HOUSING
 CAN CAUSE THE SEAR TO STICK.