

P. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 660GENERAL CONDITION: NEW R #: 27164OUTSIDE WORK: SCOPE MOUNTED DATE: 12-28-71FIRED AMMO TYPE: _____ FROM: J.W. CUMMINGS SR.& CONDITION: _____ GUN #: 127752PROOF: R.E.P. INSP.: 97 TEST: 13 CODE: PR = 6/13
BU = 1/71
RV = 2/71HEADING: O.K. GR./CAL.: 350 REM. MAG.BREECH OPENING: - CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K. APPROVED: _____CHAMBER: O.K. APPROVED: _____TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

NO DAMAGED, BROKEN COMPONENTS.SEAR-TRIGGER CONNECTOR ENGAGEMENT .025. TRIGGER
PULL 5 POUNDS - CREEPS. TOO MUCH - TOO HEAVY
LUBRICATION IN HOUSING ASSEMBLY. TRIGGER RIDES
LEFT INSIDE OF HOUSING.COMPLAINT: CREEPY TRIGGER PULL. RIFLE FIRED WHEN
BOLT HANDLE WAS RAISED.INCIDENT: FOLLOW DOWN.COMMENTS: THE CUSTOMER'S MALFUNCTION, FOLLOWING DOWN,COULD NOT BE DUPLICATED. THE EXCESSIVE LUBRICATION
WITH THE TRIGGER RIDING THE INSIDE WALL OF THE
HOUSING COULD CAUSE THE MALFUNCTION ESPECIALLY
IN COLD WEATHER.

FENGAD-Beijing, R. J.

PLAINTIFF'S
EXHIBIT

3338

12/1
AL 0030024