

Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 660GENERAL CONDITION: NEW R # : 15018OUTSIDE WORK: NO DATE: 7-28-71FIRED AMMO TYPE: _____ FROM: R.J. GRAMAZIO

& CONDITION: _____ YARMOUTH, MASS.

PROOF: R.E.P. INSPECTION 96 TEST: 32 GUN # : 6210588HEADING: O.K. CODE: LS = 2/69BREACH OPENING: _____ OK./CAL.: .308RECOIL SHOULDERS: O.K. CHECKED BY: C. PROSSERCHAMBER: O.K. APPROVED: _____TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

NO BROKEN ETC. COMPONENTS. TRIGGER CONNECTOR -SEAR ENGAGEMENT = .005 (.020 MIN.). SLIGHT UPSET ATLEFT REAR CORNER OF HOUSING CAUSED BY THE FIRINGPIN HEAD CATCHING ON IT.COMPLAINT: "GUN WENT OFF JUST PUTTING A SHELL IN THE CHAMBER"INCIDENT: FOLLOWED DOWNCOMMENTS: THERE WAS NOT ENOUGH ENGAGEMENT BETWEENTHE TRIGGER CONNECTOR AND SEAR. THIS BEING REDUCEDTO ALMOST ZERO BY A SLIGHT TRIGGER BIND, LED TO THECUSTOMER'S MALFUNCTION.

PENGLAC-Beynon, N.Y.

PLAINTIFF'S
EXHIBIT

3342

AL 0030028