

	Total	Malfunction Break Down					Other Box Related Events			•
	Endurance	Fail to	Stem	Stem	Bolt	Fail to	Straight	en Box Btm.	Doesn't	
Gun	Rds.¦Shot	Eject	Low	High	Over-ride	Feed	Вох	Detaches	Latch	
B-11	10,000	4	83	The selection of the se		1	3	1	3	
B-12	5,000	14	1	رِيَّةِ الْمُؤْمِّةِ الْمُؤْمِّةِ الْمُؤْمِّةِ الْمُؤْمِّةِ الْمُؤْمِّةِ الْمُؤْمِّةِ الْمُؤْمِّةِ الْمُؤْمِّةِ المُنْ اللهِ الْمُؤْمِّةِ اللهِ			4			
B-13	5,000	7	6		2		3	5	2	
B-14	1,000	1		7 7 1 1 1 1 1 1			3			
B-15	2,000	6	1	43.43	1967 Sec. 19		3		•	
B-16	2,000	12	4	3			13			
B-17	2,000	3	1 1	1	18 18 18 18 18 18 18 18 18 18 18 18 18 1	ξ.	12			
B-18	1,000		4		Jac	्राञ्च ভ	11	1		
B-19	1,000	20	1			ostir	11	1		
B-20	1,000	2	1		rapper		12			
-; -; -, -, -	30,000	69	100	1	4	1%	0 75	8	5	

Broken Parts:

- 1. Gun B-14: Bolt handle broke off at braze during inspection.
- 2. Gun B-12: Firing Pin broke at 1,496 rds. in thread area (replaced with pin from B-14 (1,320 rds)).
- 3. Gun B-12: One ear on Bolt Plug broken off. Noticed at 3,000 rd. inspection.

General Comments:

- 1. Gun B-11,B-12,B-13: Bolt Stop would not work 100 % of the time at approx. 3,000 rds.. Shimmed Stock to fix.
- 2. Gun B-13: Number of FTE's may be low. Chronic FTE mateunctions noted at 4,400 rds...