## Remigton Model 710 Trial and Pilot Test 100 rd. Function Test B-11 to B-20

Rem. R30064, 180 gr.SP K28G B 14 0
Rem. R30065, 180 gr. PSP L20 DA28 1 stem low, mag follower binding, replaced mag box
Rem. R30067, 220 gr. SP M06N B26 0

Technician- Bob Lee

Comments Noted- Grip Cap came off @ 51 rds.

Note- Replaced magazine with a new mag. supplied by Mayfield and resumed testing with no further malfunctions.

GUN#	Serial #	Ammo Types	Lot#	Malfunctions
B16	71001580	Rem. L30062, 150 GR. MC	M02 GC1	0
		Rem. PRT3006B, 165 gr. NBT	M01 NC0525	0
		Rem. R30064, 180 gr.SP	K28G B 14	0
		Rem. R30065, 180 gr. PSP	L20 DA28	0 34
		Rem. R30067, 220 gr. SP	M06N B26	0
Technician-	Jeff Wade			
Comments Noted-	oiled bolt @ 9 rds.		. <u></u>	* \$ 3.
	<del></del>			

GUN #	Serial #		Ammo Types	Lot#	- 15 of 15	Malfunctions	
B-17	71001583	Rem. L30062,	, 150 GR. MC	M02 GC1		90 🖟	
		Rem. PRT300	06B, 165 gr. NBT	MO1 NC0525		9	
		Rem. R30064	l, 180 gr.SP	K28G B 14		<u>,</u> Ö	
		Rem. R30065	, 180 gr. PSP	L20 DA28	San 103 San 103	0	
		Rem. R30067	, 220 gr. SP	MOGN B26		0	
Technician-	Jeff Wade						
Comments Noted-	Magazine difficult	to remove	<u> </u>				
		100		20 20 10 10 10 10 10 10 10 10 10 10 10 10 10			

#_	Serial #	- 135/25" - 28 138.	Amme Types	Lot#	Malfunctions		
B-18	7100	1584 Red L	30062, 150 GR. MO	M02 GC1	1 stem low, mag follower binding, replaced mag box		
		.∜Rem P	RT3006B, 165 gr. NBT	M01 NC052	5 0		
İ	10 mark 1985 (1985)	Rem R	30064, 180 gr.SP	K28G B 14	0		
		Bem R	30064, 180 gr.SP 30065, 180 gr. PSP	L20 DA28	0		
	- <b>15.</b> - 15	IVEIII. IV	30067, 220 gr. SP	M06N B26	0		
Technic	iao Jeff∭Wade						
Comments Noted - Box Stop broke, replaced with bolt stop from B-1 with 510 rds.							
Note- Replaced magazine with a new mag. supplied by Mayfield and resumed testing with no further malfunctions.							

GUN#	Serial #	Ammo Types	Lot#	Malfunctions
B-19	710015	95 Rem. L30062, 150 GR. MC	M02 GC1	1 stem low, mag follower binding, replaced mag box
		Rem. PRT3006B, 165 gr. NBT	M01 NC0525	2 fail to extract, extractor sticking, replaced bolt
•		Rem. R30064, 180 gr.SP	K28G B 14	0
		Rem. R30065, 180 gr. PSP	L20 DA28	0
		Rem. R30067, 220 gr. SP	M06N B26	0
Technician-	Jeff Wade			
Comments Not	ed- Grip Cap came	off @ 58 rds. and oiled bolt @ 21 rds.		
Note- Replaced	magazine with a nev	v mag. supplied by Mayfield and resume	ed testing with no furt	her malfunctions.
Note- replaced	bolt with bolt from B-	2, check headspace @ min. +.003		

GUN#	Serial_#	Ammo Types	Lot#	Malfunctions	
B-30	71001789	Rem. L30062, 150 GR. MC	M02 GC1	0	
		Rem. PRT3006B, 165 gr. NBT	M01 NC0525	0	
		Rem. R30064, 180 gr.SP	K28G B 14	0	l