

CONFIDENTIAL**Remington Arms Company Inc.**RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD

- Load the four rounds into the rifle, one in the chamber and three in the magazine, do not shoot single shot by hand-feeding single rounds into the chamber.
- Push the safe to the "fire" position,
- Fire the first round in the chamber, listen for any off-sounds, and be alert for any other unusual behavior.
- Open the bolt; eject the spent round, note any extraction or ejection problems.
- Close the bolt to load the first round from the magazine into the chamber, note any feeding or stemming problems.
- Continue to fire the remaining rounds in the magazine until the last round is fired.
- Push the Safety to "On Safe" position, the safety will be pushed to the fire position at the start of every five round trial and will be pushed to the On Safe position at the end of every five round trial. The effect of the action of the safety lever on the trigger assembly side-plate needs to be determined.
- After firing ten rounds the rifle will be checked carefully for the presence of any live ammunition and if empty will be placed in the cooling rack. The safety will be in the "On Safe" position and the bolt will be unlocked and fully open at all times. Compressed air may be used, if necessary to cool the inside of the chamber area if the rifle is excessively hot from firing.
- All malfunctions will be recorded on the data sheets

Data Required:

- Rifle serial number
- Tester's name
- Date of test firing
- The TLW#
- The ammunition used for the test with the ammo code number of the rounds actually used.
- Any malfunctions noted or other unusual items of note.

TLW0683R - Extended Function & Endurance:

This Extended Function & Endurance Test will be shot to determine an estimate of the product's expected malfunction rate over an extended period of shooting. For purposes of definition, a component failure will be one that prevents (or could prevent) the firearm from functioning as intended. These are failures that can be fixed relatively easily by the simple replacement of a part such as could be done by the gun owner using only

J.R.Snedeker

TLW 0683

Page 25 of 41

05/24/06

Remington Confidential

Revision # 1.1