

P 1/2 GUN EXAMINATION REPORT NUMBER: _____MODEL: 6801GENERAL CONDITION: GOODR # : 0010-3OUTSIDE WORK: SCOTT MOUNTEDDATE: 1-31-72

FIRED AMMO TYPE: _____

FROM: ROBERT BROWN, JR.

& CONDITION: _____

HARRISON, JR.GUN # : 127052PROOF: R.F.P.INSP.: UTEST: 13CODE: ER-10/12

LOADING: _____

GX./CAL.: 6.5MM

BREACH OPENING: _____

CHECKED BY: C. F. BROWNRECOIL SHOULDERS: O.K.

APPROVED: _____

CHAMBER: O.K.

APPROVED: _____

TEST: NO

APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style)

APPROVED: _____

RUST AROUND TRIGGER AND BETWEEN BOLT & FIRING PIN & BOLT ASSEMBLY. TRIGGER FULL 3/4" (SPEC. 4 TO 6) ENGAGEMENT .010 (SPEC. .020 MIN.)

COMPLAINT: "FIRED THREE WHEN SAFETY WAS PUT IN OFF POSITION"INCIDENT: FOLLOW DOWNPLAINTIFF'S
EXHIBIT

3259

COMMENTS: AS RECEIVED, RUST IN FIRING PIN ASSEMBLY MADE IT DIFFICULT TO CLOSE AND LOCK BOLT. FIRING PIN WOULD NOT FALL. IT IS PROBABLE THAT THE RUST AROUND THE TRIGGER CONNECTOR WHEN UNDER MINIMUM PRESSURE & UNDER MAINTAINED FIRE, CAUSED THE TRIGGER CONNECTOR TO FAIL TO EXTRACT WHEN PULLED UPON THE SAFETY OF. REPAIR: THE SAFETY ASSEMBLY THE FIRE: ON TO FALL.