

RD-6542-1 Rev. 2-15-61

Customer Complaint

J.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700

GENERAL CONDITION: GOOD R #: 19457

OUTSIDE WORK: SCOPE MOUNTED. DATE: 10-4-71

FIRED AMMO TYPE: _____ FROM: GEN. SPT. SUPPLY CO.

& CONDITION: _____ SYRACUSE, N.Y.

PROOF: R.E.P.-E INSP.: 74 TEST: 87 GUN #: 6279663

LOADING: O.K. CODE: ES-10/69

BREECH OPENING: - SN./CAL.: 5006 CHECKED BY: E. PROSSER

RECOIL SHOULDERS: O.K. APPROVED: _____

CHAMBER: O.K. APPROVED: _____

TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

NO DAMAGED OR BROKEN COMPONENTS.

COMPLAINT: FIRE WHEN SAFE IS PUSHED OFF.

INCIDENT: _____

PLAINTIFF'S
EXHIBIT
3234

COMMENTS: THE CUSTOMER'S MALFUNCTION COULD NOT BE
DUPPLICATED ANY WAY. IT WAS NOTED AND VERIFIED
BY K. CHADWICK THAT THE CUSTOMER HAD ADDED
A LUBRICANT WHICH IS TOO HEAVY (THICK) TO THE
TRIGGER ASSEMBLY. THIS, IN COLD CLIMATES WOULD
CAUSE A MALFUNCTION SUCH AS THAT CLAIMED BY
THE CUSTOMER.

AL 0029766