

Curt Gnyl.

P.I. NO GUN EXAMINATION REPORT NUMBER: _____MODEL: 700 ADLGENERAL CONDITION: GOODR #: 000130OUTSIDE WORK: SCOPE MOUNTED, BUTT PADDATE: 1-11-73FITTED.FROM: ESTELL CURRY

FIRED AMMO TYPE: _____

GATESVILLE, TEXAS

& CONDITION: _____

GUN #: 165224PROOF: R.E.P.

INSP.: _____

DTEST: B7CODE: WM = 8/65HEADING: -GA./CAL.: 24-3 IN.BREECH OPENING: -CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K.

APPROVED: _____

CHAMBER: O.K.

APPROVED: _____

TEST: NO

APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style)

APPROVED: _____

STEEL CHIPS BETWEEN TRIGGER AND CONNECTOR.HARDENED LUBRICANT AROUND SEAR. EVIDENCE OFFIRING PIN HEAD CATCHING ON REAR-LEFT CORNER OF HOUSING.COMPLAINT: FIRED AS BOLT WAS UNLOCKEDINCIDENT: FOLLOW DOWNPLAINTIFF'S
EXHIBIT

3183

COMMENTS: THE CHIPS BETWEEN TRIGGER AND CONNECTOR
CAUSE SEAR-CONNECTOR ENGAGEMENT TO VARY
LEADING TO FOLLOW-DOWN. THE HARDENED
LUBRICANT AND FIRING PIN HEAD-HOUSING INTER-
FERENCE ALSO CONTRIBUTE TO FOLLOW-DOWN
MALFUNCTIONS.

EXHIBIT

21

AL 0029713