

Cust. Complaint.

RD-6542-1 Rev. 2-15-61

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
GENERAL CONDITION: GOOD R #: 002805
OUTSIDE WORK: SWIVELS AND SCOPE MOUNT- DATE: 2-1-73
ED. FROM: FULKS SPORTING
GOODS INC.
FIRED AMMO TYPE: _____ CLARKSBURG, W.VA.
& CONDITION: _____ GUN #: 6247427
PROOF: R.E.P.-A INSP. 73 TEST: 87 CODE: K5 = 5/69
HEADING: O.K. GA./CAL.: 270 WIN.
BREECH OPENING: - CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

SEAR-TRIGGER CONNECTOR ENGAGEMENT .010 (MIN. IS .020)

CONNECTOR CLEARANCE ON TRIGGER = 1.069 (MODEL = 1.076)
DRAWING = 1.079

Ø OF TRIGGER PIN HOLE TO TOP OF TRIGGER = .974 (.973)
.971

COMPLAINT: "FIRES WHEN SAFETY IS MOVED TO FIRE POSITION."

INCIDENT: FOLLOW DOWN

COMMENTS: THE EXCESSIVE MOVEMENT BETWEEN TRIGGER &
TRIGGER CONNECTOR WILL ALLOW INTERFERENCE
BETWEEN THE SEAR AND CONNECTOR WHICH PREVENTS
RETRACTION INTO COCKED POSITION. THE PRESENCE
OF HARDENED LUBRICANT INCREASES THE POSSIBILITY
OF A MALFUNCTION.

PLAINTIFF'S
EXHIBIT

3176

AL 0029706