

W.

Subject: RE: Issues we have seen in the last 12 months with 700 Police rifles

Greg,

I discussed this with Jeff and I will respond to your list below.

Steve P.

Stephen Perniciaro, P.E., CMfgE Engineering Manager Remington Arms Company 14 Hoefler Avenue Ilion, NY 13357 315-895-3365 Fax 315-895-3670 steve.pemiciaro@remington.com

----Original Message---From: Foster, Greg
Sent: Wednesday, March 09, 2005 1:39 AM
To: McGlory, Jeffrey

Cc: Pemiciaro, Stephen; Cahan, Paul L.; Bristol II, Ronald H; Foster, Greg Subject: Issues we have seen in the last 12 months with 700 Police rifles

At our meeting two weeks ago, you ask me for problems that I have seen, my people have seen and our 700P warranty stations have seen with the 700 Police rifles.

This is a QUICK over the top summary of common problems we see

Barrel lays left - for the most part - may be corrected Improper or no crown Crooked chamber Long freebore Improper beadspace - should not be over than 1 633

Improper headspace – should not be more than 1.633 on police rifles - (this was agreed upon by our quality group early last year and I am still tooking for the confirmation email about it - will provide later on )

Bolts handles coming off Wrong bolt plug Wrong firing pin / spring ISS system used in Police rifles Heavy triggers

Inconsistent trigger pull weights (vary from 4 - 7 1/2 lbs)

Bent firecontrol pins due to softness (this has been a complaint of the US Secret Service for years and still is from our warranty stations)

Bad mag follower springs (assembled incorrectly and angled incorrectly)

Inconsistent follow springs used
Rust on follower springs
Rust on boll handles
Parko in chambers
Parko in barrels
Rust pitting in chambers
Rust pitting in barrels
Scope mount holes not straight
Poor finish / Parkerization

Wrong boil head used (should be the old style)

Bolt heads not put on straight

Scarring, gouging, from pull through reamer and rod, directly in front of chamber, very common in the last two years

Stressed barrel steel directly in front of chamber, most likely from proof load, cracks or fractures the

## steel

Problems being reported or guns sent in and returned without proper fix or no fix at all dialiming the gun is in spec...- customer just sells the rifle and moves on to someone else.

What happens in allot of these cases is the NEW gun has to be sent back for repair. killing all confidence in the rifle from the start and causing problems for the department because this rifle is needed for duty and there is no back up. I can personally tell you I sent 4 - 5 rifles out to departments last year to cover them while their NEW rifle was in for repair. This is not good

We have had Norm Chandler of Iron Brigade come in and provide consultation about or resolution for many of these problems yet we still see the problems continue.

It will be one of the main objectives of the 700 Police build area to NQT see any of these problems surface once it is up and running.

The 870 build area just suffered a set back with the results of the audit I conducted when I was in last. 5 guns out of 11 was unacceptable. The plan was supposed to be in place for the PARTS to all have been inspected and for the TRAVELER on each gun to insure the final product had been inspected. Obviously, this is not being adhered to. Paul is addressing this. But the same will be true of the 700 Police build area. Each part will be inspected before put in the crib and each gun will be inspected throughout and at the end of the assembly (Firearm attached TRAVELER)

Please let me know of any questions or concerns you have about the above.

I look forward to working with you on this project.

Gregory A. Foster Director of Sales Military, Law Enforcement and Federal Agencies 336-548-8794 - O 336-548-8798 - FAX 336-337-3528 - Mobile visit us on the WEB remingtonLE.com God Bless America

