

RECEIVING AND ESTIMATING REPORT

INITIAL IJM		CUSTOMER ORDER NO. 87782		COMMENTS			
DATE RECEIVED 12/26/91	DATE OPENED 03/04/91	DATE CODE XZ 12-75	SERIAL NUMBER A6225033	MODEL AND GRADE 700 6MM	BDL/VAR	ORDER R 91-0613	
ACCESSORIES W/STUDS		SCOPE BASE					

FROM:	SHIP TO:
AHLMAN'S ROUTE 1 BOX 20 MORRISTOWN MN 55052	AHLMAN'S ROUTE 1 BOX 20 MORRISTOWN MN 55052

COUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	CLEAN/TEST	PROM. DATE	ESTIMATED 3-19-91	VIA UPS
--------------	--------------------	--------------------------------	------------	------------	-----------------------------	-------------------

PAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
-------------	-----	-----------	-----	-------------	-------

UN CONDITION: ☐ NEW ☐ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ MARRED

CUSTOMER'S REQUEST: *Guns will fire when safety is operated or shell is chambered.*

MAIN FAULT: *1) Trigger assembly is contaminated with gummy residue; trigger and rear safety cam sticking to side plates, as received. Bolt does not surge out slow on it. 2) Trigger pull has been adjusted to 2 1/2 pounds (below 3 1/2 lbs. spec) out of factory, as evidenced by red sealant on adjustment screw. Rifle would not cock as received.*

Offer to clean and re-adjust trigger assembly to Remington spec, if possible. Or, we can install a new trigger assembly at a nominal cost, as a gesture of good-will, if it will better restore confidence in the rifle.

REPAIRMAN R.B.S.	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD4925 REV. 7/90

PPS 00058