



Deformation of the plastic bolt plug also occurred at the bolt-side front corner. This area of deformation may be seen in Figure 3.

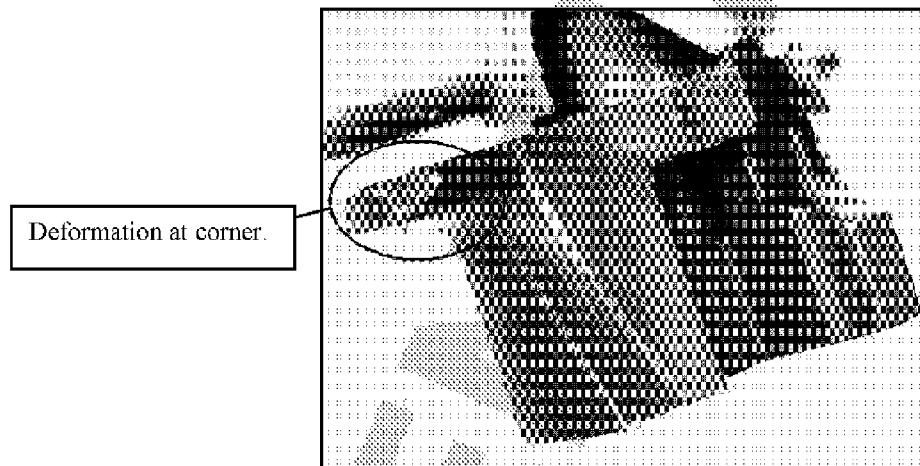

**Figure 3. Deformation at corner of 710 bolt plug.**

No areas of remarkable wear could be found on the Model 710 receiver insert.

Very little wear was seen to occur on the bolt heads of either gun. Figure 4 contains pictures of the Model 700 bolt lugs before and after the test. The amount of wear shown in the before and after pictures is almost identical.

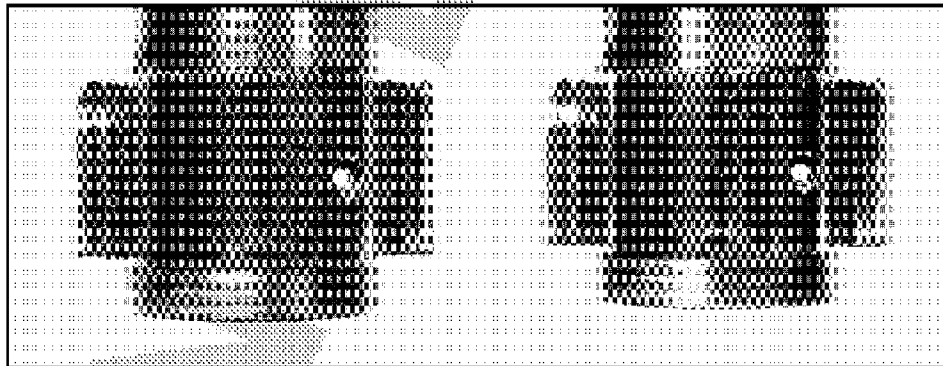

**Figure 4. 700 bolt lugs, before test (left) and after 5000 rounds (right).**