

Deformation of the plastic bolt plug also occurred at the bolt-side front corner. This area of deformation may be seen in Figure 3.

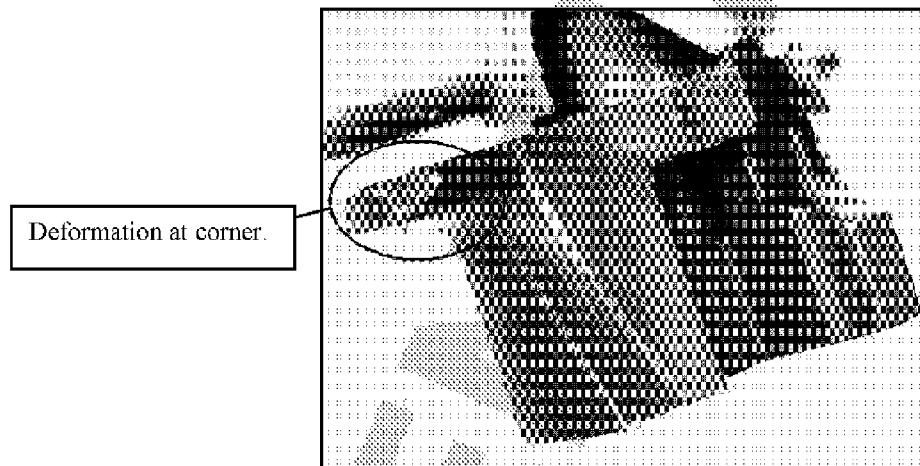


Figure 3. Deformation at corner of 710 bolt plug.

No areas of remarkable wear could be found on the Model 710 receiver insert.

Very little wear was seen to occur on the bolt heads of either gun. Figure 4 contains pictures of the Model 700 bolt lugs before and after the test. The amount of wear shown in the before and after pictures is almost identical.

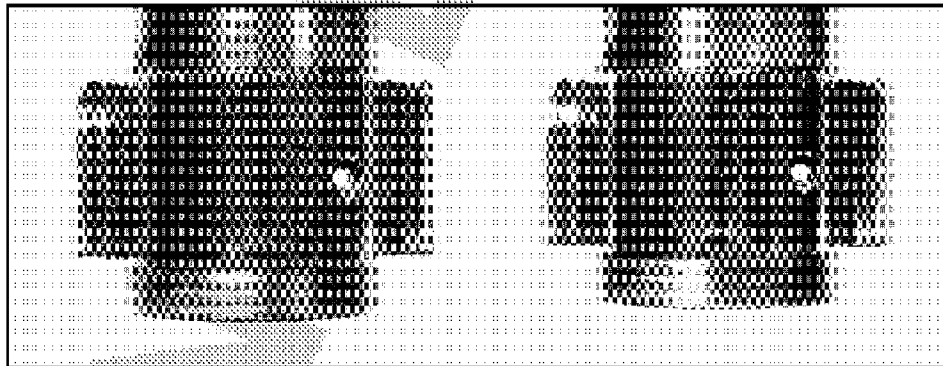


Figure 4. 700 bolt lugs, before test (left) and after 5000 rounds (right).