


CONFIDENTIAL

Remington Arms Company Inc.
 RESEARCH & DEVELOPMENT TECHNICAL CENTER
 315 WEST RING ROAD
 ELIZABETHTOWN, KY 42701

blow-up room using the high-speed video camera and witness paper. Before removing or otherwise disturbing the test samples after blow-up photographs were be taken for the record. After collection and removal of the parts additional photographs of the various individual components were taken for the record. All parts were put in sample bags, boxed and temporarily stored for later review if required.

There was no indication on the witness paper that parts were thrown in the direction of the shooter. The bolt handle broke off from the bolt. Stress from the lanyard and a poor braze joint as noted in the previous test are the probable reason for the failure. The magazine box was blown down from the action and was damaged (*see photos in section TT.W0010AY; B.1*)

The shell case was deformed by the high pressure and formed into the extractor shroud area of the bolt. The receiver and barrel experienced no obvious damage.

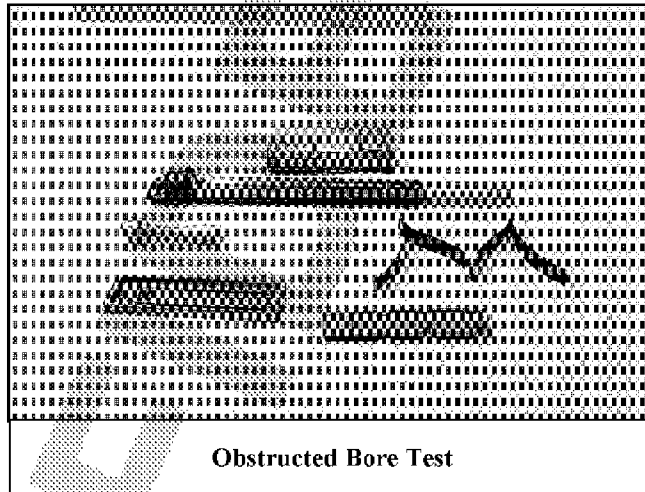

Jan 2001 Design Acceptance Test Remington M710 Centertire Rifle;
 R & D Technical Center Project No. 241039; TT.W 0100
 File: E:\Test Reports\Firearms Tests\M710_DAT_REPORT_JAN01_Rev1.doc

Page 52

CONFIDENTIAL

REV. J-652706 9/29/88

Subject to Protective Order - Williams v. Remington

BARBER 5.30.06R0002397

ETE00002196