## Remington Arms Co., Inc. **Product Service** Legal Case #:2403

Case Information

RE# Date Opened Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 145423 5/12/2008 5/13/2008 5/14/2008

Customer Information

Type Business First Name Last Name Street City State Zip Contact H 732-539-1867 143 Riverside Drive North Brick NJ 08724 Reporter Keith Pasternak E grizbear@comcast.net

Incident Information

Claims Codes Repair Est. **Medical Treatment Medical Status** 

PΙ

Cause:4015 Improper Maintenance PD

Unknown Concern:1007 Fired on Safe Release S fires on safe release

5/14/08-correspondence from repair-firing pin is releasing when safety is pushed forward. Sometimes pin drops when bolt is closed.lw

Firearm Information

**DOM** Mfg. Model/Ga. SKU Serial Bbl. Type 700/3006 SPR 77489 KP 5/1/1967 CF/BA Remington

**Date Purchased** Where Purchased Accessories Original Owner U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Reim. Date Cash Date Cash Settlement Release of Claims Release Date Reimbursement Settlement APV APV

Replace TA under smp

> Repair/Replacement Repair/Replacement Date Cost

5/14/08-quote sent to replace TA under smp.lw


Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		5/13/2008
	Product Type		RF
	Action Type	]	A
	Assigned To	]	F.SUPRY
Cause	4015	Improper Maintenance	TRIGGER ASSM DIRTY,STICKY. PARTS WORK SLUGGISH
Barrel	Description		20" 3006 SPR
	Date Code		KP
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed	1	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=2403&Type=Case

5/15/2008

,			
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Worn; Functioning	
Overall	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Slightly Worn; Functioning	
Sear	Lift	Select	.016
	Notch	Slightly Worn; Functioning	O/S TWO PIECE
	T. 4	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	WILL FOLLOW DOWN DIRTY, STICKY
	Pull	Select	4.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	

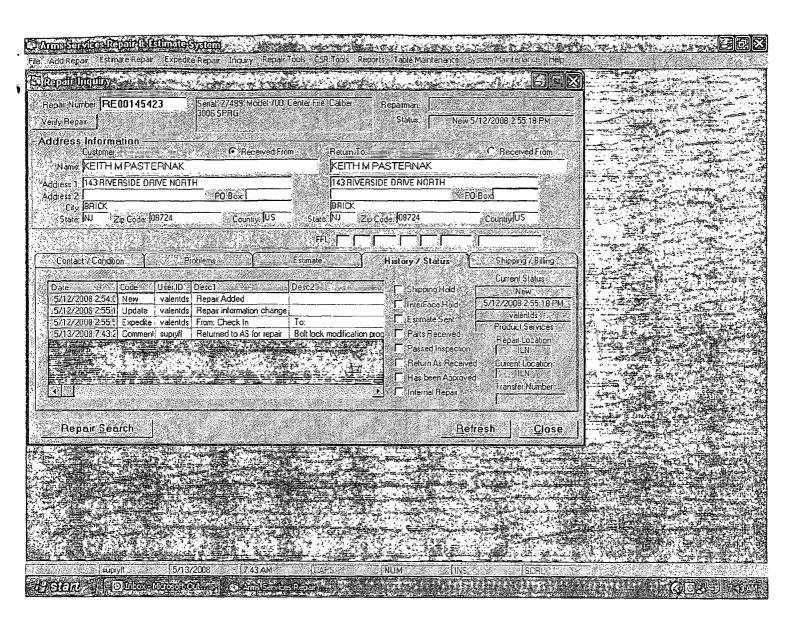



## General Repair Form

Back to Repair Services

NOTE: Please complete and print this form, and then include it with your firearm

Model Number: 700	Serial Number:	77489		
Name: Keith M Pasternak	Date of Purchase	Date of Purchase:		
Address (no PO Boxes): 143 Riverside Drive North				
City: BRICK	State: NJ	Zip: 08724		
Phone (Daytime): 732-539-1867	Fax: 732-840-1142	Fax: 732-840-1142		
E-mail Address:  grizbear@comcast.net				
Please describe your problem:				
I would like to take place in the safety modification prog the firearm will be fully inspected, cleaned and repaired				
NOTE: Prior to shipping your firearm, contact the Repai	r Center for services provided	d and estimated repair time.		
① WARNING: DO NOT SEND LIVE OR SPENT SHE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. THEM IN A SEPARATE PACKAGE AND INCLUDE NAI SERIAL NUMBER OF YOUR FIREARM.	. IF YOU FEEL YOU MUST S	SEND SPENT SHELLS PLEASE SEND		
:: Record the serial number of your firearm before sendi :: Pack your firearm for safety and to prevent further dar firearm box. (Note: Original boxes may not be returne :: Remove all accessories from your firearm to prevent i :: Ship your ENSURED firearm by either UPS or Parcel	mage in shipping and handling ed.) oss or damage.			

©2008 Remington Arms Company, Inc. All Rights Reserved. Investor Relations | Other Remington Brand Products | Legal Notices | About Us

Other Sites

TRIG. ASSM. Very dinty + Sticky.

will Follow do www. Juphace

TPA, checkoven, clean, Function

Test under bolt Lock program

Ron & 20.00 + SxH.

77	4	8	9	
Model: 7	700		-	
	- - - - -			

http://www.remington.com/support/repair\_services/general\_repair\_form.asp

5/5/2008