

Remington Arms Co., Inc.
Product Service
Legal Case #:4124

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
183322	12/15/2009	12/16/2009	12/16/2009				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Tim	Nelson	2245 W 114th St	Cleveland	OH	44102		H 216-406-7243 E tim.nelson

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	fired when safety moved to fire	Cause:4038 Concern:1007	Could Not Duplicate Concern Fired on Safe Release	Unknown
C				

12/22/09 Per note with rifle, "Gun discharged when safety was moved from "S" to "F" while attempting to open the bolt for unloading."cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPR	20000	A6731205	LV	2/16/1979
Date Purchased	Where Purchased	Accessories	Original Owner			
	MATHEWS/BOUCHER ROCHESTER NY	TWO PIECE SCOPE BASE,RINGS	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion inspection/decision, repalce TPA, clean under BLSM program price of \$20 + S&H						

Repair/Replacement Cost	Repair/Replacement Date
48.84	12/22/2009

12/22/09 Per Ilion, could not duplicate concern. Replace TPA, check over, clean under bolt lock program for \$20 + S&H.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS

Examination	Exam Date	12/16/2009	
	Product Type	RF	
	Action Type	A	
	Assigned To	F.SUPRY	
Cause	4038	Could Not Duplicate Concern	
Barrel	Description	22" 3006 SPR	
	Date Code	LV	
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description	STANDARD M/700 BOLT LOCK SAFETY	
	Function	Like new; Functioning	
Sear	Lift	---Select---	
	Notch	Like new; Functioning	
	Tests	Test Fired	
Feeding Test		False	
Trigger	Condition	Like new; Functioning	
	Pull	---Select---	
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description	TWO PIECE SCOPE BASE,RINGS	

Arms Services Repair & Estimate System

File Add Repair Estimate Repair Expedite Repair Inquiry Repair Tools CSR Tools Reports Table Maintenance System Maintenance Help

Repair Inquiry

Repair Number: **RE00183322** Serial: A6731205 Model 700 Center Fire Caliber: 3006 SPRG Produced: 02/16/1979 Repairman: Status: Repairing 12/16/2009 9:38:51 AM

Verify Repair

Address Information

Customer: **TIM NELSON** Received From: **TIM NELSON**

Name: **TIM NELSON** Return To: **TIM NELSON**

Address 1: **2245 WEST 114TH ST** Address 2: **2245 WEST 114TH ST**

City: **CLEVELAND** PD Box: **CLEVELAND**

State: **OH** Zip Code: **44102** Country: **US** State: **OH** Zip Code: **44102** Country: **US**

FPL: ☐

Contact / Condition	Problems	Estimate	History / Status	Shipping / Billing
Date	Code	User ID	Desc1	Current Status
12/15/2009 1:31	New	thomaspe	Repair Added	Repairing
12/15/2009 1:33	Expedite	thomaspe	From Check In	12/16/2009 9:38:51 AM
12/16/2009 9:38	Maint	Travisbw	Repair Maintenance	thomaspe
			<input type="checkbox"/> Shipping Hold <input type="checkbox"/> InterFace Hold <input type="checkbox"/> Estimate Sent <input type="checkbox"/> Parts Received <input type="checkbox"/> Passed Inspection <input type="checkbox"/> Return As Received <input type="checkbox"/> Has been Approved <input type="checkbox"/> Internal Repair	Repair Bench Repair Location ILN Current Location ILN Transfer Number

Repair Search Refresh Close

supyfl 12/16/2009 11:54 AM CAPS NUM INS SCRL

start Home - Maintenance Arms Services Rep... Part Search by Name Microsoft Excel Search...

27
21.84
48.84

RECEIVED
DEC 17 2009

BY:.....

4124


 LV 2/79
 2211
 6#
 1009

General Repair Form

Back to Repair Services

NOTE: Please complete and print this form, and then include it with your firearm

Model Number: 700 BDL	Serial Number: A6731205
Name: Tim Nelson	Date of Purchase: 9/2006 (Used)
Address (no PO Boxes): 2245 West 114th Street	
City: Cleveland	State: OH Zip: 44102
Phone (Daytime): 216-406-7243	Fax: 216-889-1263
E-mail Address: tim.nelson@a-wall.com	

Please describe your problem:

Gun discharged when safety was moved from "S" to "F" while attempting to open the bolt for unloading.

399 characters left

NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.

⚠ WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.

- :: Record the serial number of your firearm before sending it.
- :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
- :: Remove all accessories from your firearm to prevent loss or damage.
- :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.


Serial Number:

A6731205

out Us

Other Sit

Model: 700

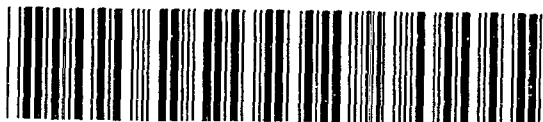

RE00183322

could not duplicate concern.
 replace TPA, check over, clean
 unzen BOLT LOCK program for
 \$20.00 + S+H