Remington Arms Co., Inc. Product Service Legal Case #:4824

Case	into	ormation

RE# Date Opened Date Opened(PS) **Date Closed Incident Date** Pre Lit Obsolete 11/18/2010 10/22/2010 11/19/2010 210864

Customer Information

Business First Name **Last Name** Street City State Zip Age Contact Type 447 Rosedale H 717-529-6805 Edward Roten Kirkwood PA 17536 Incident

Incident Information

Claims Repair Est. **Medical Treatment Medical Status** Codes

ΡI

PD Cause: 4038 Could Not Duplicate Concern

Unknown

S Fired with safety on

Concern:1028 Fired With Safe ON

10/22/10 Per call from Roten, sent to us in the 70's for repair of the bolt handle and the safety. Since then he has had it fire while on safe, in his lap when he was adjusting himself in the field.cm

Firearm Information

Mfg. Model/Ga. SKU DOM Type Serial Bbl. 700/243 WIN CF/BA 6499379 RW 11/1/1972 Remington n/a Accessories Original Owner **Date Purchased** Where Purchased

JERRYS SPT SHP OLYPHANT PA

Y

CONCERN: FIRED WITH SAFE ON

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Cash Reim. Cash Release of Claims Release Date Reimbursement Date Settlement Settlement Date APV APV

Per Ilion, replace TPA. clean at BLSM program price

Repair/Replacement Repair/Replacement Date Cost 30.23 11/22/2010

10/22/10 Sending ARS. He would like to keep it original if possible. Last time they replaced his bolt. Call with details before repairing.cm 11/22/10 Per Ilion, could not duplicate concern. Trig assm dirty and some light rust. Can offer to replace TPA, clean and test fire under bolt lock program for \$20 + shipping.cm 11/23/10 Roter approved by phone calling

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		11/19/2010
Examination	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
	Description		22" 243 WIN
	Date Code		RW
Barrel	Bore Plugged	False	
	Bulged	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4824&Type=Case

11/22/2010

<b>,</b>	Fired	False	
	Fired while Obstructed		- <del></del>
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	DIRT,BRASS WASH
	Handle	Slightly Worn; Functioning	·
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	RECEIVED LESS STOCK
Overall	Stock Condition	Select	
<u> </u>	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		STANDARD M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
-	Lift	Select	.010
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
T.	Condition	Slightly Worn; Functioning	DIRT AND SOME RUST
	Pull	Select	3.5#
Trigger	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

## Remington.

4824

October 22, 2010

22"
RW11/92
3.5#

Edward Roten 447 Rosedale Kirkwood, PA 17536

Subject: #4824

Dear Mr. Roten,

Per our conversation, enclosed is a prepaid UPS ground shipping label for shipment of the firearm to our factory. Please include a copy of the attached letter with the firearm. The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Please mark the ends of the box with "Supry".

I apologize for the inconvenience that this incident has caused and I hope that these actions will keep you as a loyal Remington customer.

Sincerely,

Christy Mitchell Consumer Affairs Administrator Phone: 800-243-9700, ext 8684 christy.mitchell@remington.com

could not duplicate concerv.
This ASSM. Dinty + some lite ilust.
en often to represe TPA, chan
A jest fine under bolt lock
I no cirain for & zo.co + ship

1/23 Enoiled quote

×

Edward Roten 447 Rosedale Rd. Kirkwood, PA 17536


6499379


RE00210864

Remington Arms Company, Inc. • 870 Remington Drive • P.O. Box 700 • Madison, NC 27025 Phone 800-243-9700 • www.remington.com

Model Number: REMINGTON 700 BDL	Serial Number: 6499379
Are you the original owner?: YES NO	
Name: EDWARD ROTEN	Date of Purchase: 1972
Address (no PO Boxes): 447 ROSEOALE	RD
City: KIRK WOOD	State: P A Zip: 17536-978/
Phone (Daytime): 7/7 527 6805	Fax:
E-mail Address:(if e-mail address is provided, notification	
Sent) EDROTEN 447 @ y A-HoC.	
I would like to receive future e-mail updates from Ren	nington.
Please describe your problem and date of occurrence:	
GUN HAS FIRED WITH S  JUST NEEP'S CHECK  BOLT WAS REPL  1973 OA 75 SAFE	EACED WAY BACK IN 1800
Edward Roten	
500 Characters left 447 Rosedale Rd. Kirkwood, PA 17536	<u>.z.</u>
Ammunition Information:	
Manufacturer: REM	Type:
Other (i.e. bullet weight/type, shot size, powder):	
Handload Information:	
Powder Used: 483/	Powder Weight: U - M
Case/Hull Used: RE **	Primer Used: STANDER
Bullet Type/Shot Size: / / DD G	Reloader Used: RC &

Firearms Care (Cleaning and Lubrication): Brand of cleaning solution used: How often do you clean the bore? (Months or Number of rounds) How often do you clean the action? (Months or Number of rounds) How often do you clean the trigger assembly? (Months or Number of rounds) Brand of lubricant used: How often do you lubricate the bore? (Months or Number of rounds) How often do you lubricate the action? (Months or Number of rounds) How often do you lubricate the trigger assembly? (Months or Number of rounds) Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual? When was the last time that your firearm was serviced by a Remington authorized repairman/gunsmith?) What were the services performed?) Remington Arms Co., Inc. Attn: Arms Service Division 14 Hoefler Avenue Ilion, NY 13357 **WARNING:** DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM, THIS IS A VIOLATION OF FEDERAL LAW, IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM. :: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Provide a return address on both the outside and inside the box. Shipments without a proper return address will be refused.

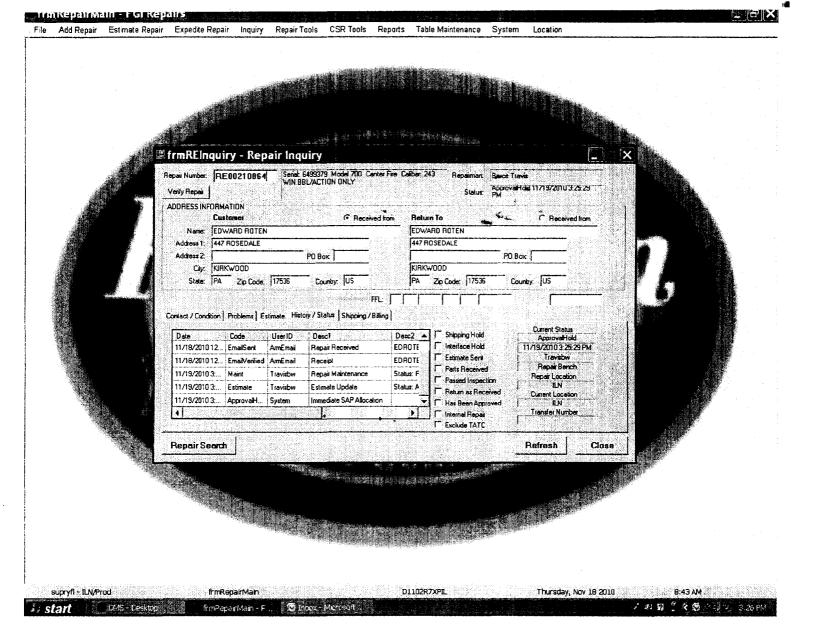





Remington Arms Company, Inc. 870 Remington Drive P. O. Box 700 Madison, NC 27025-0700

## ARS LABEL REQUEST FORM

DATE: 10/22/2010	REQUESTED BY:	christy
QUANTITY:	WEIGHT PER PACKAGE:	10
PLEASE CHECK ONE		
MEDIA		
COORDINATOR		xxxxxxxxx
TO MAIL	I WILL MAIL	
DESCRIPTION:		
70	)	·
6499379	9	

## LABEL INFORMATION

MAIL LABEL TO:	Edward Roten 447 Rosedale Kirkwood, PA 17536
RETURN ITEM TO:	Rem Product Service

## PLEASE COMPLEME ALL PARTS OF THIS FORM: AND SEND TO THE MEDIA COORDINATOR

4XX595 OCT 22, 2010 ALL CURR USD 1 OF 1 SVC GNDCOM ACT UT 10.0 LBS
TRACKING# 1Z4XX5969056641704
REF 1:EDUARD ROTEN/CD/CM
REF 2:700/6499379

HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRGS: SVC T/P USD DV 0.00 COD 0.00 RS 0.50 DC 0.00 BGD 0.00 SD 0.00 AH 0.00 PR 0.00 SP 0.00 TOT PUB CHG 7.45

