

Remington Arms Co., Inc.
Product Service
Legal Case #:6208

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
231593	5/16/2011	5/18/2011	5/18/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Perry	Locke	3025 Blackwood Dr	Florissant	MO	63033		H 314-707-1142

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Sometimes it will fire when moved from safe to fire	Cause:4006 Concern:1007	Altered Adjustments or Components Fired on Safe Release	Unknown
C				

6/2/11 Per note with rifle, this rifle has several problems related to the trigger and or safety. It is an intermittent problem that is getting worse. Sometimes the rifle will fire when the safety is moved from safe to fire without touching the trigger. Sometimes the safety will get hung up halfway between safe and fire and require wiggling to move. Sometimes after firing the bolt will not open and require wiggling to release it. Sometimes it functions fine.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/243 WIN	n/a	A6802904	DV	9/1/1979
Date Purchased	Where Purchased	Accessories	Original Owner			
	KEI K MART LAWRENCE KS	TWO PIECE BASE	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test fire under BLSM program price						

Repair/Replacement Cost	Repair/Replacement Date
30.40	6/2/2011

6/2/11 Per Ilion, trigger assm dirty and sticky, set screws altered. Replace TPA, clean and test fire under BLSM program price of \$20 + shipping. Owner approved charges by phone call to Consumer Dept on 5/19.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		5/18/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
	Description		22" 243 WIN

Barrel	Date Code		DV
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
Bolt	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
Extractor	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
Locking	Ext/Eject Test	False	
	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
Overall	Notch Condition	---Select---	
	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
Receiver	Fore End Condition	---Select---	
	Condition	Slightly Worn; Functioning	
Safety	Bulged	False	
	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Sub-Assembly	Non-ISS	
	Lift	---Select---	.013
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY,TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	---Select---	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

6208

22"
DV 9/7
25#
013

This rifle has several problems related to the trigger and or safety. It is an intermittent problem that is getting worse. Sometimes the rifle will fire when the safety is moved from safe to fire without touching the trigger. Very scary! Sometimes the safety will get hung up halfway between safe and fire and require wiggling to move. Sometimes after firing the bolt will not open and require wiggling to release it. Sometimes it functions fine. Please call me about cost if you can figure out a solution.


Thanks,
Perry Locke
314-707-1142
3025 Blackwood Dr.
Florissant, Mo. 63033

Serial # A6802904
Model 700
.243 Win

100% Satisfaction
Guaranteed

A6802904

Model: 700

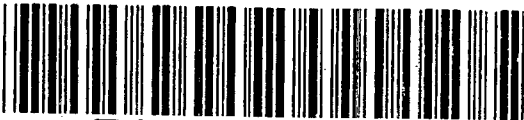

RE00231593

RECEIVED
MAY 23 2011

BY:.....

T.A. dirty sticky, set screws
altered. replace TPA, clean & test
fire under BCP Con \$ 20.00 + ship

Quote



