

Remington Arms Co., Inc.
Product Service
Legal Case #:6523

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
239522	8/30/2011	8/31/2011	8/31/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Hunter's Paradise, Inc		Hunters Paradis	136 West Lee Hwy	Chilhowie	VA	24319		H 276-646-5133

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006	Altered Adjustments or Components		
S	accidentally discharged 2 times	Concern:1025	Unexplained Discharge - No Mention of Safety Position	Unknown
C				

9/8/11 Trigger assm dirty and set screws altered. Trigger not returning properly. Replace TPA, clean, test fire at 1/2 normal cost.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/270 WIN	29709	S6230255	CN	4/2/1993
Date Purchased	Where Purchased	Accessories	Original Owner			
	DUNCAN GUN SHOP INC		U			

CONCERN:ACCIDENTAL DISCHARGE

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire at 1/2 normal cost						

Repair/Replacement Cost	Repair/Replacement Date

9/8/11 Per Ilion, trigger assm dirty and set screws altered. Trigger not returning properly. Replace TPA, clean and test fire at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		8/31/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		24" 270 WIN SS
	Date Code		CN
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.015
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	---Select---	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	

Hunters Paradise, Inc.
136 West Lee Hwy
Chilhowie, VA 24319
(276) 646-5133



24"
CN 4/93
2.5#
1.015


Remington Arms Co., Inc.
ATT: Parts Return
14 Hoefler Avenue
Ilion, NY 13357

Date: August 25, 2011

Dear Service Dept.

Please find enclosed (1) Remington Model 700, serial number S6230255. Our customer asked us to return this rifle to you for your inspection. He stated that it has accidentally discharged two times. The first time was while hunting, and the second time while removing it from the trunk of his automobile. Please make any necessary repairs and return it to the address above.

Respectively,

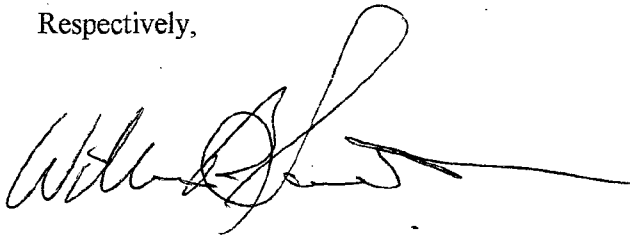

William B. Sanders
Owner

S6230255

Model: 700



RE00239522

T.A. dirty + set screws altered.
TRIG. NOT returning properly.
Ry to TPA, clean + Test fire
at 1/2 normal cost.

Quote

RECEIVED
SEP 06 2011

BY:





