

Remington Arms Co., Inc.
Product Service
Legal Case #:7115

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
252308	1/3/2012	12/19/2011	1/4/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Andre	Marquis	6587 S. Old Bald Hill Rd.	Springwater	NY	14560		C 585-319-6570 E amarquis@its.rochester.edu

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S	Concern:1007 Fired on Safe Release			
C FSR				

12/19/11: Customer called in. He stated that he had FSR with rifle about 10 days ago. He is not the original owner. No damage or injury reported. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	179219	RM	11/1/1965
Date Purchased	Where Purchased	Accessories	Original Owner			
		SCOPE BASE,BOTTOM HALF RINGS	N			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair under BLM						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$29	1/12/2012				

12/19/11: Mailing ARS & forms. df 1/12/12: Per Ilion - TA set screws altered. Trigger has min. return. Replace TA, clean & test fire under BLM - quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/4/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		22" 3006 SPRG
	Date Code		RM
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	CHECKERING REMOVED
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.004
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG HAS MIN RETURN
	Pull	---Select---	2#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE,BOTTOM HALF RINGS

7115
December 19, 2011

22"
RM11/6
2#
1000

Andre Marquis
6587 S. Old Bald Hill
Springwater, NY 14560
Phone: 585-319-6570

Ref: # 7115, Model 700, Serial # 179219

Enclosed is a prepaid UPS shipping label to cover shipment of your firearm to our factory for examination and service request.


Please include a copy of this letter and service request to put inside the shipping container. The letter and service request inside are important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Mark the ends of the box with "Product Service". Product Service will be inspecting the firearm and will contact me with the results. I will contact you once I get the report.

I hope this action will keep you a loyal Remington customer.

Sincerely,
Dell Fulcher
Consumer Affairs Administrator
Remington Arms Co., LLC
Phone: 1-800-243-9700 press 0 and ask for ext 8686
Fax: 336-548-7872

enclosure

Number: 179219
Model: 700

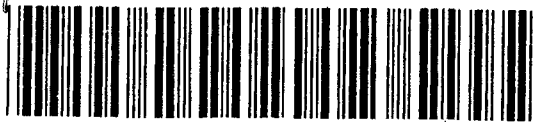

RE00252308

T.A. sep screws altered. TR19.
has min return. Rep lace TPA,
clean & test fire under BLP
Con to 20. + ship

Quote

Remington Arms Company, LLC • 870 Remington Drive • P.O. Box 700 • Madison, NC 27025
Phone 800-243-9700 • www.remington.com

Service Request

Remington Service

PO Box 700

Madison, NC 27025-0700



ATTN: Product Service

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **ENCLOSE THIS DOCUMENT WITH YOUR RETURN.**

Service Request Number	Serial Number / Description	Date of Request:	12/20/2011
SR00007107	179219	Date Printed:	12/20/2011

Model 700 Center Fire Caliber: 3006

Customer:
ANDRE MARQUIS
6587 S. OLD BALD HILL
SPRINGWATER, NY 14560 US

Destination:
Arms Services
14 Hoefler Ave
Ilion, NY 13357 US

Email:

Email:

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION

(discharged while I was unloading it)

Service Request Section

Product Service # 7115 - FSR

Parts And Service Details

Material	Type	Description	Qty Needed	Warranty	Price	Disc	Amount
----------	------	-------------	---------------	----------	-------	------	--------

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the item(s) being sent based on the conversation with our representative.

Sub Total:	.00
Est Sales Tax:	.00

Print

Reset

Model Number: 700		Serial Number: 179219	
Are you the original owner?: <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO			
Name: Andre Marguis		Date of Purchase: December 2010	
Address (no PO Boxes): 6587 S. old Bald Hill Rd			
City: Springwater		State: NY	Zip: 14560
Phone (Daytime): (585) 319 6570		Fax:	
E-mail Address: (if e-mail address is provided, notification of receipt and shipment will be sent) amarquis@its.rochester.edu			
E-mail Address: <input type="checkbox"/> I would like to receive future e-mail updates from Remington.			
Please describe your problem and date of occurrence: I was unloading the gun & it discharged - even though I am sure I did not touch the trigger.			
500 characters left			
Ammunition Information:			
Manufacturer: Remington		Type: Express Core-Lokt	
Other (i.e. bullet weight/type, shot size, powder): 150 gr 30-06 Springfield			
Handload Information:			
Powder Used:		Powder Weight:	
Case/Hull Used:		Primer Used:	
Bullet Type/Shot Size:		Reloader Used:	
Firearms Care (Cleaning and Lubrication):			

Brand of cleaning solution used:	
How often do you clean the bore? (Months or Number of rounds)	after each hunting season (I usu. shoot only 2-3x)
How often do you clean the action? (Months or Number of rounds)	Not yet (I've only shot the gun about 10-15x)
How often do you clean the trigger assembly? (Months or Number of rounds)	" "
Brand of lubricant used:	Rem oil
How often do you lubricate the bore? (Months or Number of rounds)	
How often do you lubricate the action? (Months or Number of rounds)	
How often do you lubricate the trigger assembly? (Months or Number of rounds)	
Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual? <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO	
When was the last time that your firearm was serviced by a Remington authorized repairman/gunsmith? I am unaware that it has been	
What were the services performed?)	
Ship your INSURED firearm by either UPS or Parcel Post to:	
<p align="center">Remington Arms Co., Inc. Attn: Arms Service Division 14 Hoefler Avenue Ilion, NY 13357</p>	
<p><input type="checkbox"/> WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.</p> <p align="center">:: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Provide a return address on both the outside and inside the box. Shipments without a proper</p>	

return address will be refused.

:: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.

Charge repairs will be processed using the following guidelines:

:: Repairs \$75.00 and under will be completed and returned to you C.O.D. (To avoid C.O.D. Charges, please include your credit card number and expiration date with your gun)

:: For Repairs over \$75.00, you will receive a written estimate detailing the nature of the repair, applicable taxes and shipping. You will have 30 days to approve the repair estimate. Repairs can be paid by check, money order, or credit card (American Express, Discover, MasterCard, or VISA). If you wish, you can expedite repairs over \$75.00 by setting a pre-authorized amount that can be billed to your credit card. We process checks electronically through Check21.

ARS LABEL REQUEST FORM

DATE: 12/20/2011	Service Request # SR00007107
QUANTITY: 1	WEIGHT PER PACKAGE: 10 LBS
REQUESTED BY: fulcherdm	
email address: I WILL MAIL LABEL	

Business:

Remington Service
PO Box 700
Madison, NC 27025-0700
www.Remington.com

LABEL INFORMATION

MAIL LABEL TO:	ANDRE MARQUIS 6587 S. OLD BALD HILL SPRINGWATER, NY 14560 US SR00007107 Email:
RETURN ITEM TO:	ILN Arms Services



4XX596 DEC 20, 2011 ACT WT 10.0 LBS #PK 1
SVC GNDCOM BL WT 10.0 LBS
TRACKING# 124XX5969066972035
REF 1:SR00007107
REF 2:

HANDLING CHARGE 0.00	FRT: 3RD
SHIPMENT PUB RATE CHARGES:	SVC T/P USD
DV 0.00	RS 0.50
DC 0.00	
AH 0.00	ROD 0.00
TOT PUB CHG 7.94	PUB + HANDLING 7.94

ATTN: Product Service



