Remington Arms Co., Inc.
Product Service
Legal Case #:6740

Case Information

 RE#
 Date Opened
 Date Opened(PS)
 Date Closed
 Incident Date
 Pre Lit
 Lit
 Obsolete

 244567
 10/25/2011
 10/26/2011
 10/26/2011

Customer Information

Type Business First Last Name Street City State Zip Age Contact

Reporter AF Jeppson Gunsmith AF Jeppson Guns Dr West Valley UT 84128 W 801-450-Guns Dr City UT 84128 W 801-450-

Incident Ken Riddle

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD Cause: 4006 Altered Adjustments or Components

Concern: 1008 Fired on Bolt Closing

Unknown

S Fired on bolt closing Conce

11/10/11 Per note with rifle, gun fired after closing bolt with safety off.cm

Firearm Information

Mfg. Type Model/Ga. SKU Serial Bbl. DOM

Remington CF/BA 700/7MM REM MA 20000 B6420397 EC 10/1/1982

Date Purchased Where Purchased Accessories Original Owner

WESTERN HOEGEE CO GLENDALE CA SCOPE BASE U

CONCERN:FBC

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Reim. Date Cash Date
Settlement APV APV

Replace TPA, clean, test fire at 1/2 normal cost

Repair/Replacement Repair/Replacement
Cost Date

11/10/11 Per Ilion, trigger assm dirty, sticky and set screws altered. Trigger not returning properly. Replace TPA, clean, test fire at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		10/26/2011
Examination	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	IMPROPER MAINTENENCE
Barrel	Description		24" 7MM REM MAG
	Date Code	$\Box$ .	EC
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=6740&Type=Case

11/10/2011

		<u> </u>	_
	Fired while Obstructed		_
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor  Locking  Overall	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	· · · · · ·
	Stock Condition	Slightly Worn; Functioning	MARS, DENTS
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
	Description		M/700 SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	.010
Sear	Notch	Slightly Worn; Functioning	
	T	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY PARTS WORK SLUGGISH WILL FOLLOW DOWN
	Pull	Select	4.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		SCOPE BASE

## AF JEPPSON GUNSMITH LLC

801-450-7731

Cogito ergo armatus sum

To whom it may concern,

This Remington Model 700 s/n: B6420379 7mm Rem. Mag., owned by Mr. Ken Riddle, has been sent in for repair c/o

REFERENCE NO.1: SR00000610

When the repairs are complete please ship this firearm to:

AF JEPPSON GUNSMITH LLC

3663 Royal Scott Drive

West Valley city, Utah 84128

Thank you,

Adam Jeppson

B6420397

PE00244547

SHIPPED MOVE : PAID

T.A. dipty, sticky + set scruss
Altered. Trig. Not wturning
properly. Replace TPA, clean+
Test Rine At 1/2 Normal cost.


Quote

SHIPPED NOV - 1 PAID

## 💲 frmRepairMain - FGI Repairs



File Add Repair Estimate Repair Expedite Repair Inquiry Repair Tools CSR Tools Repeats Table Maintenance System Location

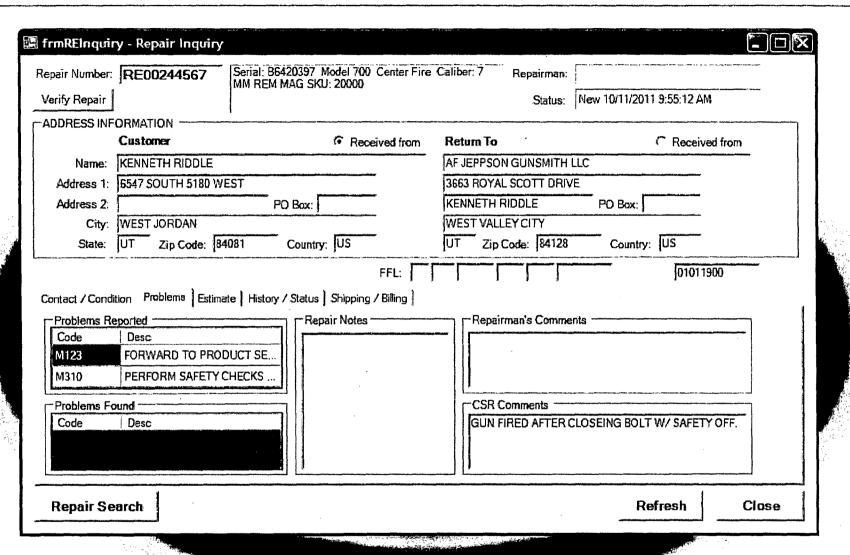

Travisbw - ILN/Prod

frmRepairMain

ILASRPR 11 -

Wednesday, Oct 26 2011

4:07 AM

