

Remington Arms Co., Inc.
Product Service
Legal Case #:7376

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
257581	2/6/2012	2/7/2012	2/7/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	R&L Archery		R&L Archery	70 Smith St	Barre	VT	05641		W 802-476-9151

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				

PI

PD

S Fired when closing bolt Cause:4038 Could Not Duplicate Concern

C Concern:1008 Fired on Bolt Closing

Unknown

2/23/12 Per note with rifle, customer said he closed the bolt to load the rifle and the cartridge discharged.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/270 WIN	n/a	6727517	CY	4/1/1974
Date Purchased	Where Purchased	Accessories	Original Owner			
	ESTRN SPTS DIST MILFORD NH	TWO PIECE BASE	U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test at BLSM program price						

Repair/Replacement Cost	Repair/Replacement Date
30.40	2/23/2012

2/23/12 Per Ilion, could not duplicate concern. Trigger assm dirty and set screws altered. Replace TPA, clean, test at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/7/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 270 WIN
	Date Code		CY
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	

Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Scar	Lift	---Select---	.006
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY
	Pull	---Select---	3#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

R&L ARCHERY Inc.

70 Smith St.

Barre, VT 05641

tel: 1-802-479-9151 1-800-269-9151

fax: 1-802-476-1377

www.RandLarchery.com



7376

2/2/12

22"
C44/94
3#
.006

1- Rem 700 S# 6727517

Customer wanted to send back
for Safety recall.
he said he closed bolt ~~and~~
~~and~~ to load rifle and
the cartridge discharged.

Please Repair

6727517

Model: 700



RE00257581

Thanks


CHC

RECEIVED
FEB 09 2012

BY: _____

could not duplicate concern
T.A. dirty + set screws altered
replace TPA, clean + test under
BCL Gun 820. + ship

Quote

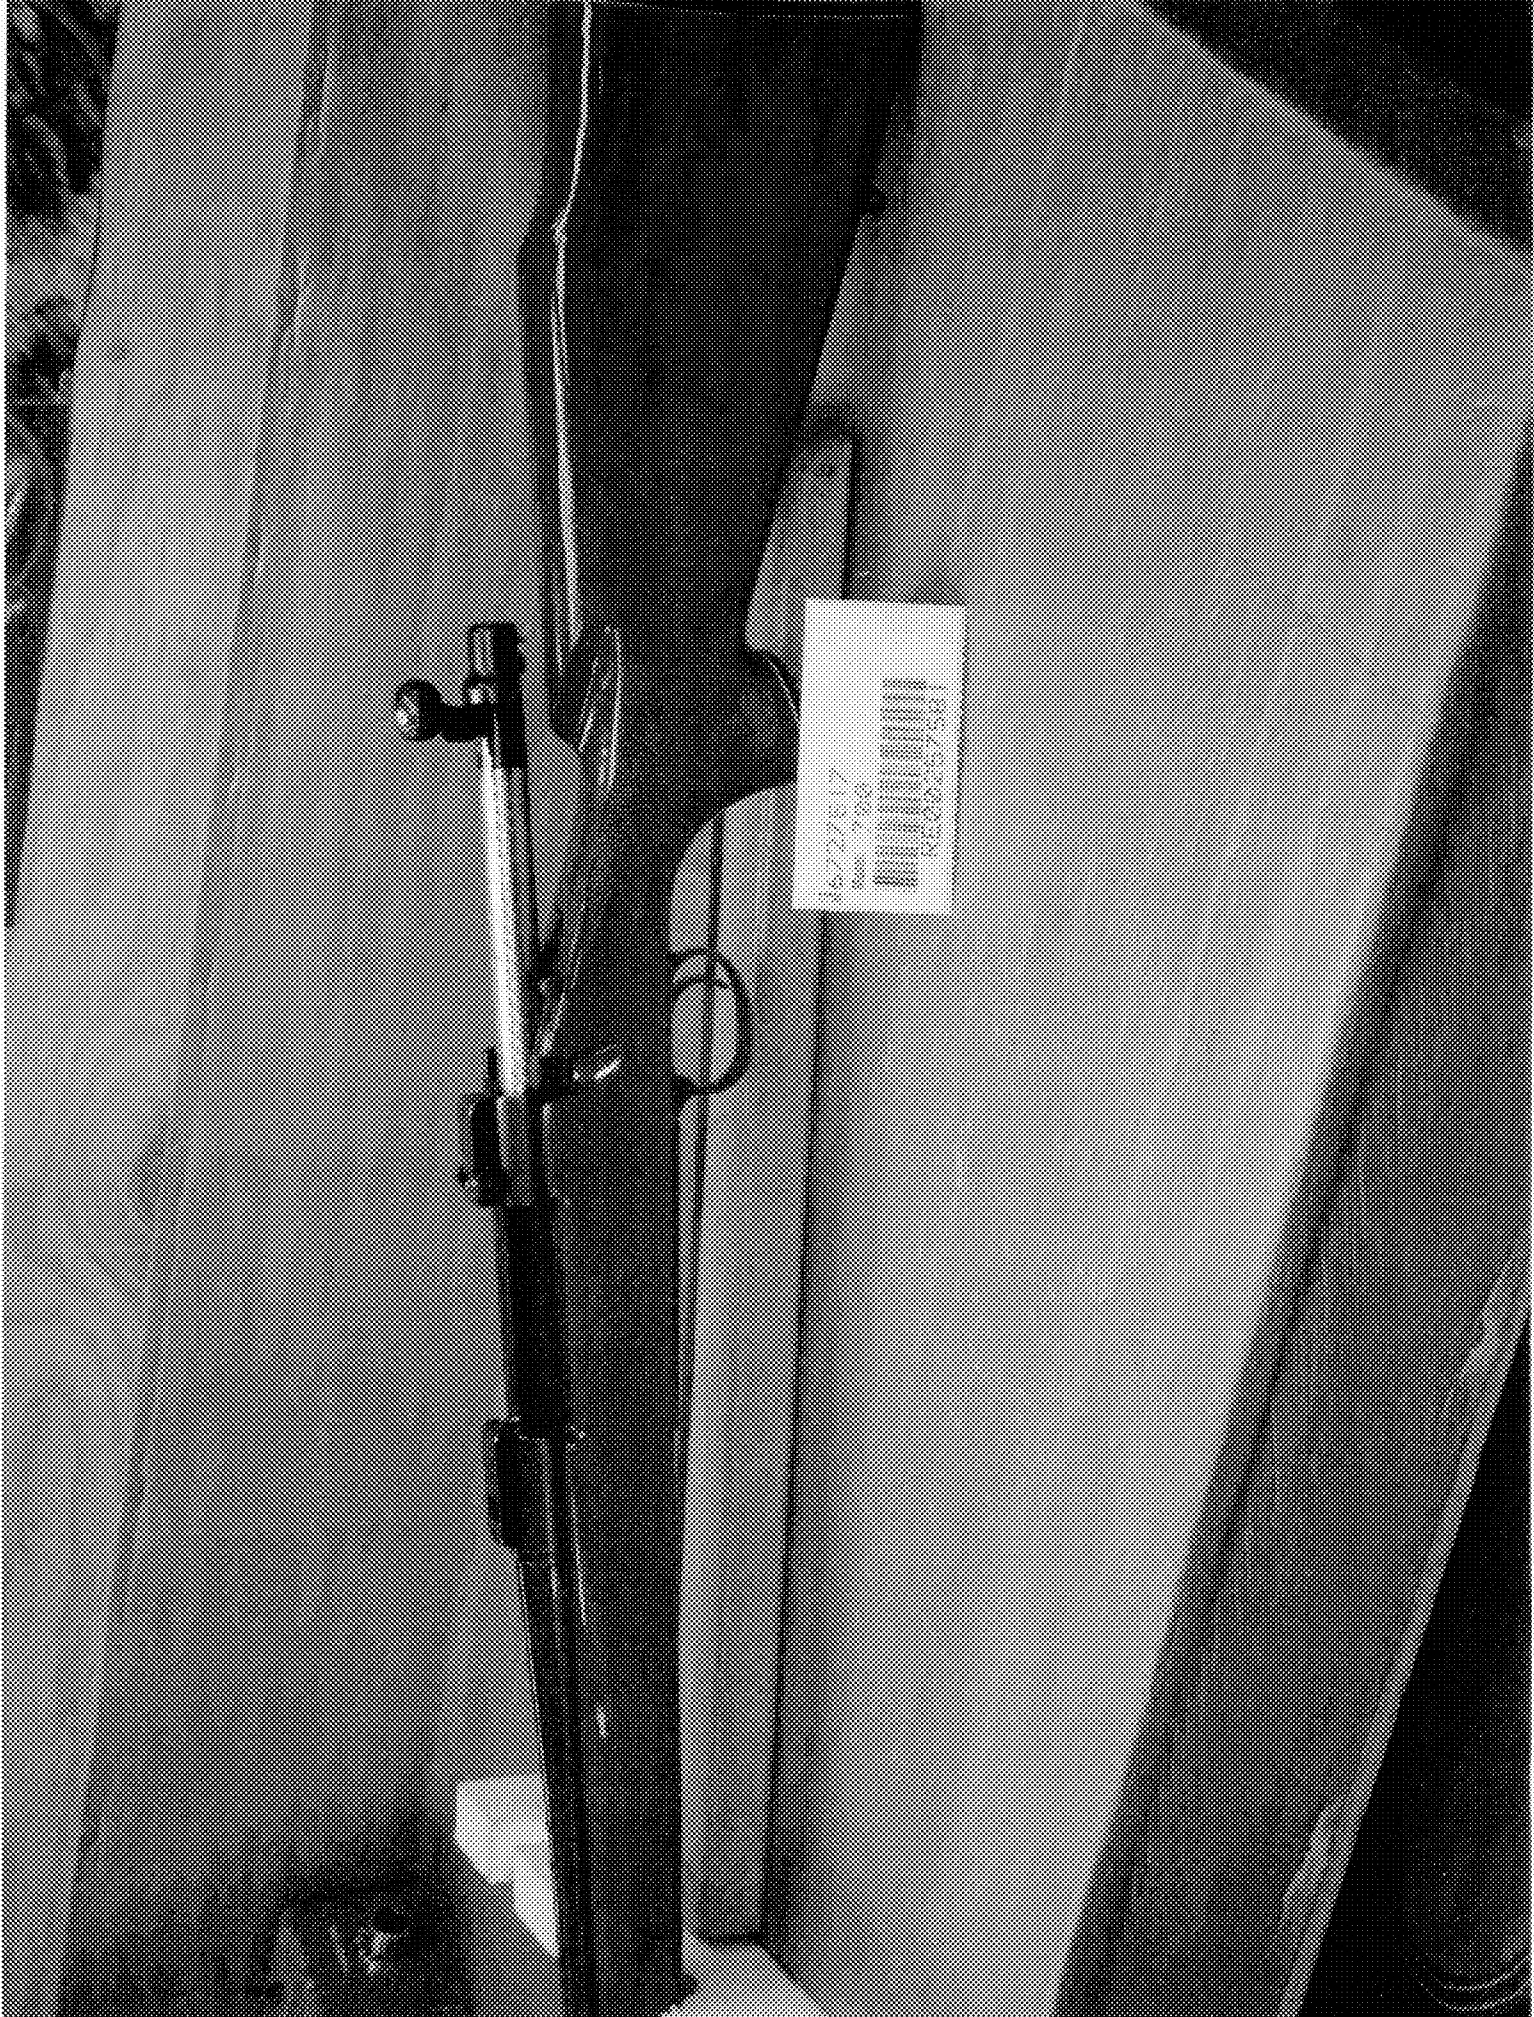

16727817
Rev 700
K2002575H

