

File Number:	9615	Arms Service number:	19720358
Last Name:	HOFFMAN	First Name:	DOUG
Street:	UNIVERSITY OF GEORGIA	City:	ATHENS
State:	GA	Zip:	30602
Work Ph:		Home Ph:	
Type Concern:	S	Product Type:	F A T O
PI PD P S C:		Concern Code:	1007
Concern:	FIRED ON SAFE RELEASE		
Cause Code:	4006	Cause:	ALTERED ADJUSTMENTS OR COMPONENTS
Assigned To:	KAT	Classification:	UNJ UNJ UNC UND J
Settlement Detail:	REPAIR SPCL PRICE	Settlement Amount:	\$0.00
Date Opened Rem:	11/24/97	Date Opened by PS:	12/1/97
Date of Incident:		Date Closed:	12/2/97
Date to Analyze:		Date from Analysis:	
Model:	700	Serial:	E6256342
RAHAC:	700	Litigation:	
Custody:		Prelitigation:	
		Caliber:	270
		Bullet Weight:	
		Manufacturer:	REM
		Date Mfg:	4/1/96
		Obsolete:	<input type="checkbox"/>
		Comments:	SEAR ENGAGEMENT ALTERED TO AN UNSAFE CONDITION
Time of Modification:	3:13:35 PM	Date of Modification:	12/1/97

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER

R 97-20358

INITIAL CUSTOMER ORDER NO.

Product
BOTTOM HALF OF MOUNTS ONLY Service
DBL HAS BEEN ALTERED

DATE RECEIVED 11/21/97 DATE OPENED 11/24/97 DATE CODE CQ 4-96 SERIAL NUMBER E6256342 NEW SERIAL NUMBER MODEL AND GRADE 700 270 VS/SENDERO
ACCESSORIES HARD CASE SCOPE BASE

FROM:

SHIP TO:

HOFFMAN, DOUG M
USDA WILDLIFE SERVICES
UNIVERSITY OF GEORGIA
ATHENS GA 30602

HOFFMAN, DOUG M
USDA WILDLIFE SERVICES
UNIVERSITY OF GEORGIA
ATHENS GA 30602

CUST NO: 177826 C.O.D.

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

PROM. DATE

ESTIMATED

VIA

11/26/97 UPS

GUN CONDITION

- ☐ NEW
☐ LIGHTLY WORN
☐ WORN
☐ VERY WORN
☐ UNREPAIRABLE
☐ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

100.00

Visa # 4716-1234-0003-4648

CUSTOMER CONCERN AMMO FUNCTION FINISH REPAIRS

CYCLE

A1

TRIGGER GROUP

BOLT ASSY.

B3

BARREL ASSY.

REC. ASSY.

B5

WOOD

METAL

MAIN FAULT

- 1) *Remington trigger as of interfacer with bolt release*
2) *Shaves brass on closing*
3) *Trigger pin releases when safe is taken off*
4) *Bolt sometimes does not cock on closing*
5) *Re blue barrel to keep from rusting*
1) *Trig. pin front was driven too far in bonding release.*
2)
3 & 4 *Trigger altered to an unsafe condition outside of the factory.*
5) *Blue bl. as requested*

PARTS

COMMENTS

*Trig Assy**Re blue bl.**Trig pull 1/2 to 1 1/4 LBS pull as recd.*

- Seat engagement near zero.*
- powder pull screw backed out.*

Remington does not recommend that the trig be adjusted outside of the factory.
Repair at Guesin price strictly as a gesture of good will.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD6925 REV 7-97

Remington Arms Company
November 13, 1997
Page 2

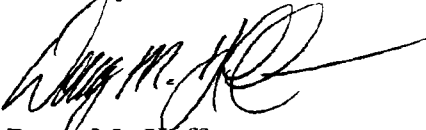
This rifle is property of the United States Department of Agriculture and is used for collecting nuisance white-tailed deer. It may be called on to fire up to 30 rounds in one day and may have several hundred rounds cycled through it over the course of a year. To date, there have been approximately 400 rounds fired through it. The gun is shot exclusively with a silencer attached, explaining the work on the barrel.

If possible, I would like for you to blue the end of the barrel to prevent rust build-up. The silencer manufacturer did not finish the barrel after the turning and threading process and constant maintenance is required to keep this section clean.

Any charges for repairs should be applied to my U. S. Government Visa number 4716-1234-0003-4648, expiration date 11/98. If you have any questions, I may be reached at 706/546-2020.

Thank you for your assistance with this matter.

Sincerely,

A handwritten signature in dark ink, appearing to read 'Doug M. Hoffman', with a long, sweeping horizontal stroke extending to the right.

Doug M. Hoffman
Wildlife Biologist