

File Number:	21721		Arms Service number:	103374	
Last Name:	READINGER		First Name:	TERRY	
Street:	140 ARBORETUM ROAD		City:	BERNVILLE	
State:	PA	Zip:	19506	Home Ph:	610-488-7564
Work Ph:		Product Type:	F	F A T O	
Type Concern:	PI	PI PD P S C	Concern Code:	1007	
Concern:	FIRED ON SAFE RELEASE - THUMB				
Cause Code:	4015	Cause:	IMPROPER MAINTENANCE		
Assigned To:	SUPRY	Classification:	UND	UNJ UNC UND J	
Settlement Detail:	REPAIR N/C		Settlement Amount:	\$65.00	
Date Opened Rem:	11/14/2005	Date Opened by P/S:	10/26/2005	Caliber:	243
Date of Incident:	10/15/2005	Date Closed:	11/15/2005	Bullet Weight:	
Date to Analysis:		Date from Analysis:		Manufacturer:	
Model:	673	Serial:	7788330	Date Code:	PX
RAMAC:	673	Litigation:	☐	PreLitigation:	☐
Custody:		Obsolete:	☐		
Time of Modification:	2:13:43 PM				
Date of Modification:	11/1/2005				
Comments:		While on a guided hunt the rifle discharged when the safety was moved. He says it was stuck and he had to put additional pressure to move safety. Injured thumb, ARS label and letter sent 11/1/05. Trigger and trigger pin rusted causing trigger to bind. Clean action and install new TA n/c as gesture of goodwill. Charge 230145.			

{ PS 7227 }

6/10/03

6/03

Serial
Number:

7788330

Model: 673



RE00103374

DEAR FRED,

I WAS IN NEW BRUNSWICK, CANADA BEAR + DEER HUNTING. ON THE FIRST DAY OF THE HUNT, MY GUIDE AND I WENT TO MY BEAR STAND. WHEN I LOADED THE RIFLE, I LOOKED MY SAFETY WAS JAMED IN BETWEEN FIRE AND SAFETY. I OPENED THE BOLT HALF WAY AND THEN CLOSED THE BOLT. THEN I COULD MOVE THE SAFETY TO SAFE. TO MAKE SURE THE SAFETY DIDNT JAM BETWEEN FIRE AND SAFETY AGAIN, I PUSHED THE SAFETY TO FIRE WITHOUT MY FINGER ON THE TRIGGER. THE RIFLE FIRED IN THE AIR. THE RECOIL MADE THE SAFETY KNOB TEAR INTO THE TIP OF MY THUMB, RIPPING IT OPEN, CLOSE TO THE BONE. THE NEXT DAY I LOADED THE RIFLE AGAIN KNOWING THE PROBLEM, I WAS PREPARED FOR WHAT COULD HAPPEN. AND THE SAME THING HAPPENED TWO TIMES. I KNOW THAT REMINGTON MAKES A VERY FINE FIRE ARM AND I BELIEVE THIS WAS A VERY RARE INCIDENT. DUE TO THE DEFECT IN MY RIFLE, I WOULD LIKE REMINGTON TO REPAIR OR REPLACE MY MODEL 673 - 350 MAG. FOR THE INCONVENIENCE ON MY HUNTING TRIP AND MY INJURY I WOULD LIKE REMINGTON TO GIVE ME A MODEL 700 BDL. IN 338 MAG. I WOULD LIKE TO GO FOR LARGE BEAR, ELK, MOOSE SOME DAY. I HOPE YOU WILL HONOR MY REQUEST. I HAVE ALWAYS PURCHASED REMINGTON AND WILL CONTINUE TO DO SO.

REPAIR AS NEEDED w/c

Charge 230145

Please expedite!

FLS 11/15/05

TERRY L. READINGER

140 ARBORETUM RD.

BERNVILLE PA. 19506

121014007564

SINCERLY,

Terry L. Readinger

PS 7228

Serial
Number:

// 88330

Model: 673



RE00103374

6/03
DEAR FRED,

I WAS IN NEW BRUNSWICK, CANADA BEAR + DEER HUNTING. ON THE FIRST DAY OF THE HUNT, MY GUIDE AND I WENT TO MY BEAR STAND. WHEN I LOADED THE RIFLE I LOOKED MY SAFETY WAS JAMED IN BETWEEN FIRE AND SAFETY. I OPENED THE BOLT HALF WAY AND THEN CLOSED THE BOLT. THEN I COULD MOVE THE SAFETY TO SAFE. TO MAKE SURE THE SAFETY DIDN'T JAM BETWEEN FIRE AND SAFETY AGAIN I PUSHED THE SAFETY TO FIRE WITHOUT MY FINGER ON THE TRIGGER. THE RIFLE FIRED IN THE AIR. THE RECOIL MADE THE SAFETY KNOB TEAR INTO THE TIP OF MY THUMB, RIPPING IT OPEN, CLOSE TO THE BONE. THE NEXT DAY I LOADED THE RIFLE AGAIN KNOWING THE PROBLEM, I WAS PREPARED FOR WHAT COULD HAPPEN. AND THE SAME THING HAPPENED TWO TIMES. I KNOW THAT REMINGTON MAKES A VERY FINE FIREARM AND I BELIEVE THIS WAS A VERY RARE INCIDENT. DUE TO THE DEFECT IN MY RIFLE, I WOULD LIKE REMINGTON TO REPAIR OR REPLACE MY MODEL 673 - 350 MAG. FOR THE INCONVENIENCE ON MY HUNTING TRIP AND MY INJURY I WOULD LIKE REMINGTON TO GIVE ME A MODEL 700 BDL. IN 338 MAG. I WOULD LIKE TO GO FOR LARGE BEAR, ELK, MOOSE SOME DAY. I HOPE YOU WILL HONOR MY REQUEST. I HAVE ALWAYS PURCHASED REMINGTON AND WILL CONTINUE TO DO SO.

SINCERLY,

Terry L. Readinger

TERRY L. READINGER

140 ARBORETUM RD.

BERNVILLE PA. 19506

PS 7229

Date: 11/14/05

By: Bruce Travis

FIREARM INSPECTION WORKSHEET

BACKGROUND

Customer name: Terry L. Rendinger

R.E. Number: 103374

Reason for inspection: FSR

FIREARM

Manufacturer: Rm.

Model: 673

Serial Number: 7788330

Date of Manufacture: 6/03

Overall external condition: Good

Barrel condition: OKAY

Receiver condition: OKAY

Stock condition: OKAY

Bolt/firing pin condition: OKAY

Trigger assembly condition:

Engagement: —

Adjustments/alterations: —

Other: TRG + PIN RUSTED/BINDING

Headspace: —

Function evaluation:

File Number:	21934		Arms Service number:	105560	
Last Name:	VIGNEAULT		First Name:	DENNIS	
Street:	12 SLEEPER ROAD		City:	SUNAPEE	
State:	NH	Zip:	03782	Home Ph:	603-863-4874
Work Ph:		Product Type:	F	F A T O	
Type Concern:	S	PI PD P S	Concern Code:	1007	
Concern:	FIRED ON SAFE RELEASE				
Cause Code:	4015	Cause:	IMPROPER MAINTENANCE		
Assigned To:	SUPRY	Classification:	UND	UNJ UNC UND J	
Settlement Detail:	NEW TA N/C		Settlement Amount:	\$65.00	
Date Opened Rem:	12/21/2005	Date Opened by P/S:	12/21/2005	Caliber:	300 SAUM
Date of Incident:		Date Closed:	12/21/2005	Bullet Weight:	
Date to Analysis:		Date from Analysis:		Manufacturer:	REM
Model:	673	Serial:	7783074	Date Code:	AX
RAMAC:	673	Litigation:	☐	PreLitigation:	☐
		Obsolete:	☐		
Custody:		Comments:	Trigger assembly rusty - clean action and install new TA at n/c - charge 230145. Repair and Shipping Document 2/20/06		
Time of Modification:	2:09:17 PM				
Date of Modification:	12/21/2005				

PS 7232



TRACKING DOCUMENT

Repair Order Number



Repair Order Number

RE00105560

Description/Serial Number

7783074

Repairman - Dale Lewis

Date Received - 12/21/2005

Account # - R-

Model 673 Center Fire Caliber: 300
GUIDE RIFLE

Estimate Date -

Current Date - 12/27/2005

Customer

DENNIS VIGNEAULT
12 SLEEPER ROAD

Return To

DENNIS VIGNEAULT
12 SLEEPER ROAD

SUNAPEE, NH 03782 US

SUNAPEE, NH 03782 US

Phone (H) (603)-863-4874

Fax

Phone (W)

Email

Problems

Reported

M123 FORWARD TO PRODUCT SERVICE
FOR INSPECTION
M207 FAILS TO COCK
M992 FIRED WHEN MOVING SAFETY

Found

M123 FORWARD TO PRODUCT SERVICE F

Repair

Material # MaterialDesc

Quantity
Needed

Quantity
From Inv

Quantity
From Kit

Warranty
(Y/N)

Part

F92458 7 TRIGGER ASSB

Part Total:

1	1	0	Y
1	1	0	

Service

4000104 ARMS SERV SHIPPING & HANDLING

4000119 GR-TEST

4000294 GR-CHECK TPA

Service Total:

0	0	0	Y
1	1	0	Y
1	1	0	Y
2	2	0	

ProblemNotes

rusted ta, clean action and install new ta n/c per product service


Repairman	Proof	Clean	Test	Target	Pattern
Gallery Tester	Date	Date	Date	Date	Date

PS 7233

Serial Number:

7783074

Model: 673

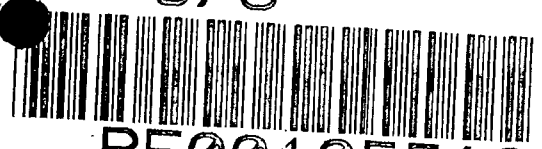

RE00105560

Remington.

Owner Instructions
(fill out this form, and then include it with your firearm.)

Serial Number: 7783074

Are you the original owner?: ☒ YES ☐ NO		
Name: Dennis Vigneault		Date of Purchase: 01/2004
Address (no PO Boxes): 12 Sleepex Rd.		
City: Sunapee	State: N.H.	Zip: 03782
Phone (Daytime): (603) 863-4874	Fax:	
E-mail Address:		
☒ I would like to receive future e-mail updates from Remington. sdvigneault@adelphia.net		
Please describe your problem: Fired when I pushed safety off if happened twice. I put the safety right through my thumb. It doesn't cock when I left bolt up and down.		
Ammunition Information:		
Manufacturer: Remington	Type: Premier S.A. ultra mag	
Other (i.e. bullet weight/type, shot size, powder): 150 grain		
Handload Information:		
Powder Used:	Powder Weight:	
Case/Hull Used:	Primer Used:	
Bullet Type/Shot Size:	Reloader Used:	
Firearms Care (Cleaning and Lubrication):		
Brand of cleaning solution used: Scent eliminating Gun Cleaning System		
How often do you clean the bore? (Months or Number of rounds) after each hunt		
How often do you clean the action? (Months or Number of rounds) after each hunt		
How often do you clean the trigger assembly? (Months or Number of rounds) have not		
Brand of lubricant used: Invisible Gun		

Date: 12/21/05
By: FRED SUPRY

FIREARM INSPECTION WORKSHEET

BACKGROUND

Customer name: Dennis Vigneault
R.E. Number: 105560
Reason for inspection: FSR

FIREARM

Manufacturer: Rem Model: 673
Serial Number: 7783074 Date of Manufacture: AX-
Overall external condition: good

Barrel condition: ok
Receiver condition: ok
Stock condition: ok
Bolt/firing pin condition: ok
Trigger assembly condition:
Engagement: ok
Adjustments/alterations: ok
Other: Reset
Headspace: —
Function evaluation:

