Remington Arms Co., Inc. Product Service Legal Case #:2994

Case Information

**Date Closed Incident Date** Obsolete RE# Date Opened(PS) Pre Lit Lit **Date Opened** 12/18/2008 12/18/2008 157302 12/17/2008

Customer Information

Zip Last Name Street City Age Contact **Business** First Name State Type 11559 William Penn Hwy 16652 Reporter Big 4 Outdoors Big 4 Outdoors Huntingdon PA

Incident Information

Repair Est. **Medical Treatment Medical Status** Claims Codes

PΙ

Cause: 4015 Improper Maintenance PD

Unknown

S fired after releasing safety

Concern: 1007 Fired on Safe Release

12/22/08 customer alledges that as soon as you put the safety to fire the gun goes off.cm

Firearm Information

Mfg.

Type

Model/Ga.

SKU 29543 Serial Bbl.

**DOM** 

Remington **Date Purchased**  CF/BA

7/7MM SAUM

2/4/2003 2:40:28 PM 7783755 LX

Where Purchased

Accessories

**Original Owner** 

**GLENN ZANDERS FUR & SPORT** 

U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/7/CF/BA

Settlement Release of Claims Release Date

Reimbursement

Cash Settlement Reim. Date APV

Cash Date APV

repair at no charge, goodwill

Repair/Replacement

Repair/Replacement

Cost 65.00


Date 12/22/2008

12/22/08 trigger and trigger pin rusty, dry and binding. Will follow down. Replace TPA, check over, clean at no charge per Supry.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/18/2008
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	
Barrel	Description		22" 7MM SAUM
	Date Code		LX
	Bore Plugged	False	
	Bulged	False	]
	Fired	False	]
	Fired while Obstructed		_
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	7

ı	1		· · · ·
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/7 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	ISS	
Sear	Lift	Select	N/A
	Notch	Like new; Functioning	
	T4-	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG AND PIN RUSTY, DRY BINDING
	Pull	Select	N/A
	Altered	False	
	Sub-Assembly	Other Remington	

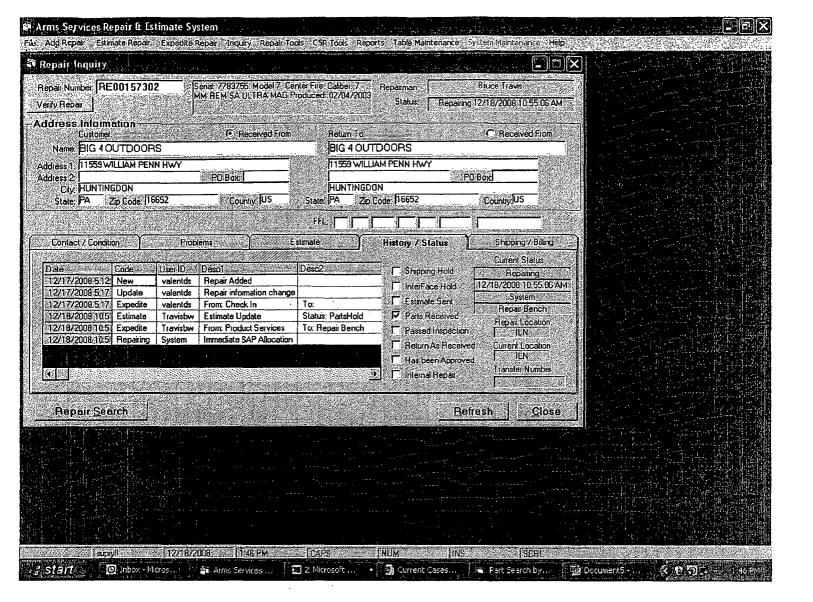








RE00157302

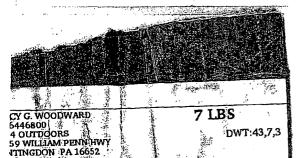

IIP TO:

ATTN: CONSUMER REPAIRS

8002/439700

REMINGTON ARMS SERVICES

14 HOEFLER AVENUE

LION NY 13357-1816

As Soon as You Flot the Safety to fire the gun goes off, Trig. +Trig. PIN RUSTY, DRY AND BINDING. WIII Collow down. replace TPA, check over, chan AT N/L