Remington Arms Co., Inc. **Product Service** Legal Case #:3045

Case Information

Date Closed RE# Date Opened(PS) **Incident Date** Pre Lit Lit Obsolete **Date Opened** 1/9/2009 1/9/2009 1/8/2009 158325

Customer Information

Type **Business** First Name **Last Name** Street City State Zip Age Contact Hollie 2107 Golden Pond Drive H 281-360-6973 77345 Incident Charles Kingwood TX

Incident Information

Medical Repair Medical Codes Claims Est. Treatment Status

ΡI

PD Could Not Duplicate Cause: 4038

Concern Unknown S

Concern: 1007 Fired on Safe Release Rifle discharges when moved from Safe С

Rifle has been in storage since about 1976. Rifle discharges when safety is moved from Safe to Fire. Bolt safety modification needed. dmf

Firearm Information

Model/Ga. SKU Serial DOM Mfg. Type Bbl. 700/243 WIN 20000 6604401 RW 11/1/1972 Remington CF/BA

Original Owner Where Purchased Accessories **Date Purchased**

SALT LAKE HD SALT LAKE UT TWO PIECE SCOPE BASE U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Reim. Date **Cash Date** Cash Settlement **Release of Claims** Release Date Reimbursement Settlement APV APV

> Repair/Replacement Repair/Replacement Cost Date

\$47.38


1/14/09: Estimate sent for \$37.36 for Bolt Lock Modification Program. dmf

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		1/9/2009
Examination	Product Type		RF
	Action Type		A
	Assigned To		F./SUPRY
Cause	4038	Could Not Duplicate Concern	RUSTY AND DIRTY METAL PARTS AND TPA BORE RUSTY/DIRTY
	Description		22" 243 WIN
	Date Code		RW
Barrel	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed	d	
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	BOLT BODY RUSTY

h •	h	n	1
	Shroud	Slightly Worn; Functioning	
n. It	Face	Slightly Worn; Functioning	
Bolt	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	<u> </u>
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	METAL RUSTY
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
C-6-h.	Description		STANDARD M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Lift	Select	.006
Sear	Notch	Like new; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	RUSTY/DIRTY
Trigger	Pull	Select	6#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE

PS 09705

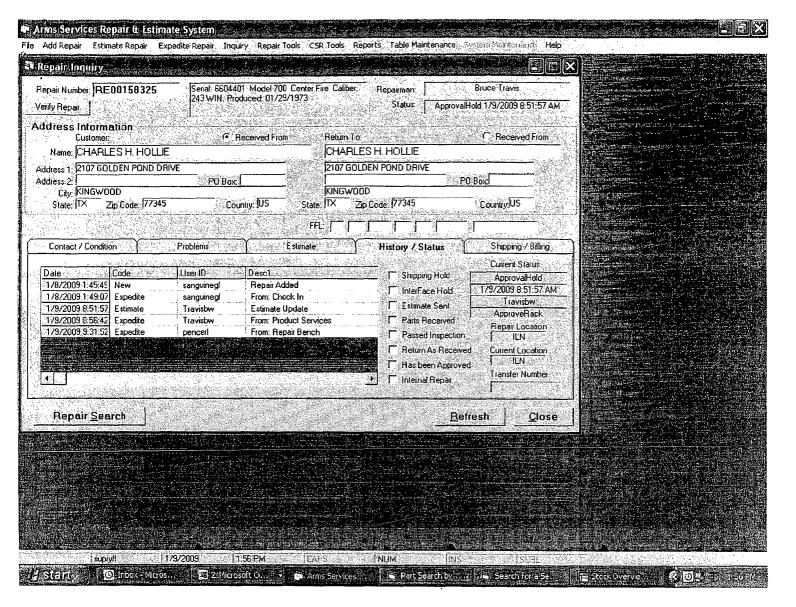

Bott lock modification program.



General Repair Form

Back to Repair Services

NOTE: Please complete and print this form, and then include it with your firearm

Model Number: 700 (.243 Winchester) Serial Number: 16604401

could not dup 1, conte concern Aplace TOA, check over, Clep v under Bolt Local Programkon \$20,00 +S+A

	i						
Name: Charles H. Hollie	Date of Purchase: About 1974						
Address (no PO Boxes): 2107 Golden Pond Drive							
City: Kingwood	State: TX	Zip: 77345					
Phone (Daytime): 281-360-6973	Fax:						
E-mail Address:							
Please describe your problem:							
Please note the following:							
Rifle has been in storage since about 1976. Rifle discharges when safety is moved from safety ("S") to fire ("F"). Bolt safety modification needed. Other modification programs might apply.							
Thanks	•						
247 characters left		<u>-1</u>					

6604401



IS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND PARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND 3ER OF YOUR FIREARM.

3: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE

serial number of your firearm before sending it. earm for safety and to prevent further damage in shipping and handling. Preferably, ship in a (Note: Original boxes may not be returned.) accessories from your firearm to prevent loss or damage. NSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss nent, so you may elect to purchase insurance from your carrier.

NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.