Remington Arms Co., Inc. **Product Service** Legal Case #:2737

Case Information

Date Opened(PS) **Date Closed Incident Date** Obsolete RE# Pre Lit Lit **Date Opened** 151928 9/30/2008 10/1/2008 10/1/2008

Customer Information

Business First Name Last Name Street City State Zip Contact Type Age H 715-595-6419 27261 259th St Jeff Labelle Holcombe WI 54745 F 612-677-3853 Reporter E jeff@labelle.com

Incident Information

Codes **Medical Status** Claims Repair Est. **Medical Treatment**

PI

PD

Cause:4038 Could Not Duplicate Concern

S fired on safe release Concern: 1007 Fired on Safe Release

Unknown

10/3/08-correspondence from repair-gun has fired on safe release on multiple occasions. Please modify the bolt lock mechanism and repair or replace the trigger assembly.lw

Firearm Information

Mfg.

Type

Model/Ga.

SKU

Serial Bbl.

6798569

DOM

Remington

CF/BA Where Purchased 700/3006 SPR Accessories

Original Owner

10/1/1974 EY

Date Purchased

TWO PIECE SCOPE BASE

U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA Reimbursement

Cash Settlement Reim. Date APV

Cash Date APV

BLM

Settlement

Program

Repair/Replacement Cost

Release of Claims

Repair/Replacement Date

Release Date

10/1/2008 Returned to AS for bolt lock modification program fls.


Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		10/1/2008
Examination	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	
* * * * * * * * * * * * * * * * * * * *	Description		22" 3006 SPR
	Date Code		EY
Barrel	Bore Plugged	False	
	Bulged	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=2737&Type=Case

10/3/2008

,	Fired	False	
	Fired while Obstructed		-
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	·
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning]
	Condition	Slightly Worn; Functioning]
Extractor	Cut Condition	Slightly Worn; Functioning]
	Ext/Eject Test	False]
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select]
n'	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False]
0-6-4	Description		STANDARD M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Lift	Select	.011
Sear	Notch	Like new; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	DIRTY
Triana	Pull	Select	6#
Trigger	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE

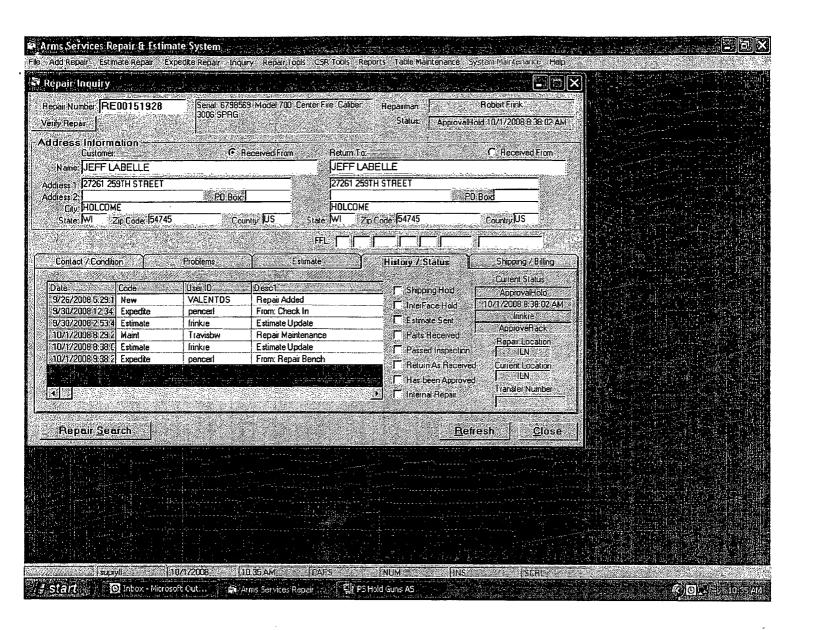



General Repair Form

NOTE: Please complete and print this form, and then include it with your firearm

Back to Repair Services *

Model Number: M 700 / 36-06	Serial Number: 6798569					
Name: JEFF LABELLE	Date of Purchase: ABOUT 1970					
Address (no PO Boxes): 27261 25974 57.						
City: HOLCOMBE	State: WT	Zip: 54745				
Phone (Daytime): 7/5-595-6419	Fax: 6/2-677-3853					
E-mail Address: jeff elabelle. com						
Please describe your problem:						
I BOUGHT THIS GUN NEW MOLE THAN 35 YEARS						
AGO. THIS GUN HAS FIRED ON SAFETY RELEASE						
ON MULTUPLE OCCASTONS. PLEASE MODIFY THE						
BOLT LOCK MECHANTSIN AND REPATR DR						
REPLACE THE TREGGER ASSEMBLY.						
500 characters left / HTMN YOU!						
NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and efficiency						
● WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE						
FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND						
SERIAL NUMBER OF YOUR FIREARM.	,	<i>y</i>				
:: Record the serial number of your firearm before sending it.						
:: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)						
:: Remove all accessories from your firearm to prevent loss or damage.						
:: Ship your ENSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.						

©2008 Remington Arms Company, Inc. All Rights Reserved. Investor Relations | Other Remington Brand Products | Legal Notices | About Us Other Sites

could not duplicate concern. Tiling. ASSM very dirty.

Pup bace TPA, check over,

chan under bolt Lock

program Rox \$ 20.00