Remington Arms Co., Inc. Product Service Legal Case #:2947

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Obsolete

156472 12/6/2008 12/8/2008 12/8/2008

Customer Information

Type **Business** First Name Last Name City State Zip Age Contact

9170-C Airport Blvd Mobile AL 36608 Mobile Shooting W 251-633-8629 Reporter Mobile Shooting Center

Incident Information

Claims Codes Repair Est. **Medical Treatment Medical Status** 

PI

PD Cause:4038 Could Not Duplicate Concern Concern: 1007 Fired on Safe Release

Unknown

C

Customer says, This gun fires when safety is released, It had had 2 misfirs due to this issue. Please repair and return fls.

Firearm Information

S fired on safe release

Mfg. Type Model/Ga. **SKU** Serial Bbl. DOM Remington CF/BA 700/3006 SPR 20000 A6477367 OO 7/7/1965

**Date Purchased** Where Purchased Accessories **Original Owner** 

J C PENNY TUCKER GAREPAIRS0 SOFT CASE, SLING U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims

Release Date

Reimbursement Cash Settlement Reim. Date APV Cash Date APV

**BLM Program** 

Repair/Replacement Cost Repair/Replacement Date

45.00

12/11/2008


12/8/2008 Returned to AS for bolt lock modification program. Install new TA and clean action quote \$20 plus shipping and handling fls.

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment .
Examination	Examiner		B.TRAVIS
	Exam Date		12/8/2008
	Product Type		RF
	Action Type	,	A
	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 3006 SPR
	Date Code		00
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
		Ir	1

1	Handle	Slightly Worn; Functioning	1
			=
	Stop	Slightly Worn; Functioning	╡
Extractor	Condition	Slightly Worn; Functioning	_
	Cut Condition	Slightly Worn; Functioning	
Locking	Ext/Eject Test	False	
	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
Overall	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
Doorium	Fore End Condition	Select	
	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		STANDARD M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Lift	Select	.009
	Notch	Like new; Functioning	
	T4-	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	Select	4.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SOFT CASE, SLING

http://ama02.am12.200/maaamm/DrintDiamlar, aamy91D-20479-Trum-------------------

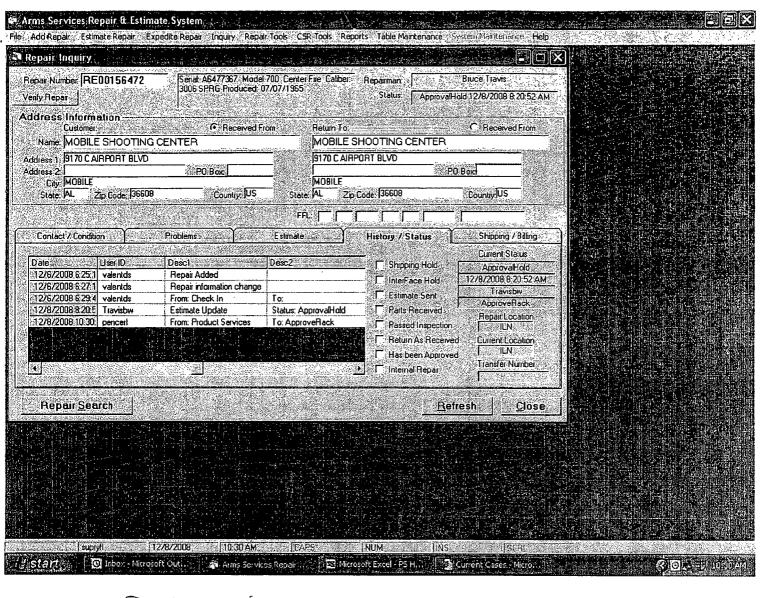

Returned to AS for Bott lock

modification program. Installing new

TA & cleaning action.

FLS

BY: 09 2008

PS 09934

**MOBILE SHOOTING CENTER** 9170-C Airport Blvd. **MOBILE, AL 36608** (251) 633-8629 STOMER'S ORDER NO. PHONE DATE 11-24-08 emington 700 30-04 A4477367 C.O.D. | CHARGE | ON ACC ON ACCT. MDSE. RET'D. PAID OUT DESCRIPTION PRICE AMOUNT dTY. repair and Thanks, TAX RECEIVED BY TOTAL PRODUCT 610 All claims and returned goods must be accompanied by this bill. Thank You

## BA6477367

Model: 700



RE00156472

rould not captimite concern tymes the check over, clean anden both war programs Con & 20.00, +5x4.