Remington Arms Co., Inc.
Product Service
Legal Case #:2933

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete 156100 12/2/2008 12/3/2008 12/3/2008

Customer Information

Type **Business** First Name Last Name Street City State Zip Contact 3110 Evergreen Rd Fort Wayne Schultz Jerry A IN 46818 Reporter

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

ΡI

PD Cause: 4006 Altered Adjustments or Components
Unknown

S Fired with Safe ON Concern:1007 Fired on Safe Release

C

Customer says when he takes the safety off sometimes the gun goes off.

Firearm Information

Mfg. Type Model/Ga. SKU Serial Bbl. DOM CF/BA 700/223 REM 27514 E6639110 CU 4/7/2000 Remington **Date Purchased** Where Purchased Accessories **Original Owner**

BILL HICKS & CO LTD TWO PIECE SCOPE BASE

U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Reim. Date Cash Date

Release Date Reimbursement Settlement APV APV

New TA special price

Repair/Replacement Cost Repair/Replacement Date

-- 12/3/2008 our examination found the trigger adjustments screw positions had been altered creating a condition that would cause the firing pin to follow down. The trigger would not properly return under the seat due to the improper adjustment. Returned the rifle to AS to check over, clean the action, and install a new TA at 1/2 normal charges as a gesture of goodwill fls.


Examination[Remington/CF/BA]

12 200/

Part	Sub-Part	Code	Comment
Examination	Examiner]	B.TRAVIS
	Exam Date]	12/3/2008
	Product Type		RF
	Action Type]	A
	Assigned To		F.SUPRY
Cause	4006	Altered Adjustments or Components	
Barrel	Description		24" 223 REM
	Date Code		CU
	Bore Plugged	False]
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning]
	Firing Pin	Slightly Worn; Functioning	1

^			₹
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	<u>]</u>
	Handle	Slightly Worn; Functioning]
	Stop	Worn; Functioning]
	Condition	Slightly Worn; Functioning]
Extractor	Cut Condition	Slightly Worn; Functioning	
Locking	Ext/Eject Test	False]
	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select]
D	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False]
	Description]	STANDARD M/700 SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	.013
Sear	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test	lests	False	
	Condition	Slightly Worn; Not Functioning	WILL FOLLOW DOWN
T. *	Pull	Select	2.5#
Trigger	Altered	True	TRIGGER SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE

PS 10027

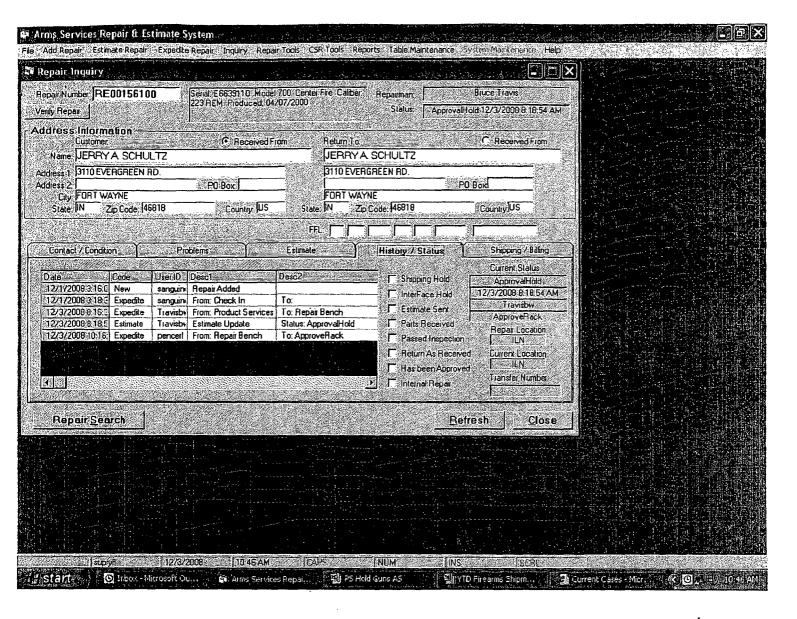

properly return under sear due to morpher adjustments.

Peterned to AS to checkover, clean the action, and motall a new TA at 12 normal charges as a gestive of good will,

Dear Remington,

2933

24" 25" 213 , 013

My name and address is

JERRY A. Schultz 3110 Exergreen Road FORT WAYNE Indian A 46818

I have bought this Remington 200

It is a 223 cal., when I go to take

Safety off sometimes gun goes off.

Safety off sometimes gun goes off.

I think you will agree this is not

I think you will agree this is not

good or safe. Please fix it for me.

good or safe. Please fix it for me.

Any questions my Phone number is 260-484-9873

Any charges please let me Know.

THANKYOU VERY MUCH JERRY A Schultz

Zeno Trita. Return Trig. ASSM Set Screws ALTERED, Fir. PIN WIII Lollow down. Rephre TRA, check oven clear AT 1/2 Non mal charges.

Quote

E6639110

Model: 700

