

Remington Arms Co., Inc.  
Product Service  
Legal Case #:2213

## Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
142490	3/5/2008	3/6/2008	3/6/2008				

## Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Between the Walls	Between the Wal		1707 N Big Spring St	Midland	TX	79701		

## Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		
S	fires on bolt closing	Concern:1008 Fired on Bolt Closing	Unknown	
C				

3/7/08-correspondence from repair-when chamber round, gun goes off.lw

## Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl	DOM
Remington	CF/BA	600 MOHAWK/243 WIN	20000	6431462	LW	2/1/1972
Date Purchased	Where Purchased	Accessories	Original Owner			
	WEST TEX WHLSE ABILENE TX	SCOPE BASE	U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

## Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace TA at n/c						
	Repair/Replacement Cost	Repair/Replacement Date				
	35.00	3/7/2008				

3/7/08-replace TA at n/c under recall.lw

## Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		3/6/2008
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	ACTION AND TRIG ASSM DIRTY STICKY TPA NOT UPDATED
Barrel	Description		19" 243 WIN VT
	Date Code		LW
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

	Fired while Obstructed		
	Muzzle/Crown Condition	Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/600 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY STICKY
	Pull	---Select---	4#
	Altered	False	
	Sub-Assembly	Other Remington	
Non-Remington Components	Description		SCOPE BASE

\_\_\_\_\_

...the ...

Customer:	Received From:	Return To:	Received From:
-----------	----------------	------------	----------------

For a complete list of all the products and services we offer, please visit our website at [www.fox.com](http://www.fox.com). We are not responsible for the content or accuracy of any information posted on our website. We reserve the right to change our website at any time without notice. We are not responsible for the content or accuracy of any information posted on our website. We reserve the right to change our website at any time without notice.

[illegible]

Current Status

\_\_\_\_\_

[illegible]

From:

2213

Between The Walls  
1707 N. Big Spring St.  
Midland, TX 79701  
PFL #575-329-01-0A-00319

19"  
4#  
LW2/72  
.007

CUST. Says whe chamber  
Round it goes OFF

Please correct & Let us know  
of charge - 432. 687-4867


THANKS



Serial  
Number:

6431462

Model: 600 MOHAWK

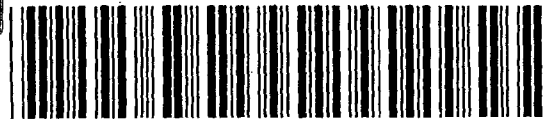

RE00142490

Could not duplicate concern  
TPA HAS NOT BEEN updated.  
Replace TPA, check oven, clean  
w/arden T rig assm recalc AT N/C

#2301K15