Remington Arms Co., Inc.


	•		Product Ser	vice							
			Legal Case #	:4785							
Case Information											
	•		PS) Date (Closed Inc /2010	Incident Date		Pr	Pre Lit Li		t Obsolete X	
Customer Information											
Type Business	First Name	Last Name	Street	Ci	ity	State	Zip	Age		Contact	
Incident	Ray	Trejo	2001 Dona Ana	Rd. SW Den	ning	NM	88030		Н 5	75-494-5507	
Incident Information											
Claims		Codes			Repair Est.			Medical Treatment		Medical Status	
PI											
PD	Cause:4038	Could Not De	uplicate Concern								
S	Concern: 103	25 Unexplained	Discharge - No Mer	ntion of Safety			Uı	Unknown			
S Concern: 1025 Unexplained Discharge - No Mention of Safety C Gun fired accidentally											
Customer wrote in a ne	ote - He is sendir	ne us this rifle to	renair The gun we	nt off accidentally	dmf						
		-8 -0									
Firearm Information				•							
Mfg.	Туре		Model/Ga.		SKU			Serial Bbl.	Bbl.		
Remington		CF/BA	600/243 WI	= :	n/a		65	960	PN	6/1/1966	
Date Purchased	•		nal O [.] U	wner							
CONCERN:GONE OF	FF ACCIDENTI	v			U						
CONCERN.GONE OF		, 1									
Ammunition Informati	on - None Defin	ed									
Other Products Inform	ation - None Def	fined									
Settlement											
			Remington/600	/CF/BA							
Settlement	Release of C	laims	Release Date	Reimbursement	t Se	Cash ettleme		Reim. AP		Cash Date APV	
Per Ilion - Repair @ n/c											
	Repair/Repla	cement Rej	pair/Replacement					•			
Cost \$43.48			Date 10/20/2010							•	
10/20/10: Per Fred S	•			all Safety check to	est fir	e at n/c	dmf				
			, , , , , , , , , , , , , , , , , , ,							·	


Sub-Part	Code	Comment
Examiner		B.TRAVIS
Exam Date		10/13/2010
Product Type		RF .
Action Type		A
Assigned To		F.SUPRY
4038	Could Not Duplicate Concern	O/S TPA
Description		18.5" 243 WIN
Date Code		PN
Bore Plugged	False	
Bulged	False	
Fired	False	
Fired while Obstructed		
	Examiner Exam Date Product Type Action Type Assigned To 4038 Description Date Code Bore Plugged Bulged Fired	Examiner Exam Date Product Type Action Type Assigned To 4038 Could Not Duplicate Concern Description Date Code Bore Plugged False Bulged False Fired False

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4785&Type=Case

10/20/2010

	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False .	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
Safety	Description		STANDARD M/600 BOLT LOCK SAFETY
Salety	Function	Like new; Functioning	
Sear	Lift	Select	N/A
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	16212	False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	Select	3#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	Other Remington	·

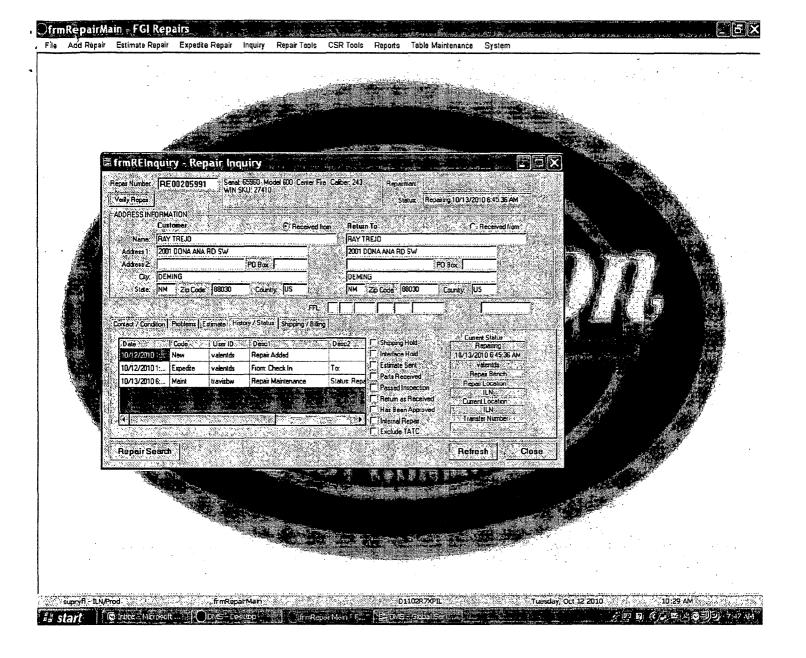



4785

Dear Remington,

I am sending you this model 600 to you for a repair on the trigger. This gun has gone off accidently. Thank you for returning this back to me asap... My grandchildren have a hunt at the end of this month.

Thank you,

Ray

Return Address:

Ray Trejo 2001 Dona Ana RD. SW Deming, NM 88030 575-494-5507



replace TPA UNDER NECA !!.

SALLY CLECK& TRUTFINE AT

H/C #230145