

Remington Arms Co., Inc.
Product Service
Legal Case #:5395

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
214001	12/10/2010	12/13/2010	12/13/2010				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Cabelas	---	Cabelas	812 13th Ave	Sidney	NE	69160		W n/a
Incident		Thomas	Vogen	21621 Oldfield Ave. N.	Scandia	MN	55073		H 651-433-2737

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038 Could Not Duplicate Concern		Unknown	
S	Concern:1008 Fired on Bolt Closing			
C FBC				

Customer sent gun in with a letter. He stated that he was using rifle on opening day of deer season and had a FBC. No damage, No injury. He stated he has read about problems with this model gun. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPR	n/a	6297222	BT	1/1/1970
Date Purchased	Where Purchased	Accessories	Original Owner			
		SCOPE,RINGS,TWO PIECE BASE,HARD CASE	U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Repair under BLM program						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$60.40	1/5/2011				

Per Ilion - Could not duplicate concern. TA set screws altered. Replace TA, clean & test fire under BLM program - quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/13/2010
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 3006 SPR
	Date Code		BT
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	N/A
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	2#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE,RINGS,TWO PIECE BASE,HARD CASE

frmRepairMain - FGI Repairs

File Add Repair Estimate Repair Expedite Repair Inquiry Repair Tools CSR Tools Reports Table Maintenance System Location

frmREInquiry - Repair Inquiry

Repair Number: RE00021401 Model: 1100 with 26 inch barrel 12 gauge RC/VT Repairman: Bruce Travis
 Verify Repair: Status: Closed 1/27/2001 9:48:24 AM

ADDRESS INFORMATION

Customer: CABELAS Received from: CABELAS
 Name: CABELAS Return To: CABELAS
 Address 1: 812 13TH AVE Address 1: 812 13TH AVE
 Address 2: PO Box Address 2: PO Box
 City: SIDNEY City: SIDNEY
 State: NE Zip Code: 69160 Country: US State: NE Zip Code: 69160 Country: US

Contact / Condition Problems Estimate History / Status Shipping / Billing

Date	Code	User ID	Desc1	Desc2
1/23/2001 8:1	New	baryfi	Repair Added	
1/23/2001 1:3	Closed	baryfi		
1/27/2001 9:4	ReOpened	travisbw		
1/27/2001 9:4	Estimate	travisbw	Estimate Update	Status: A
1/27/2001 9:4	Estimate	travisbw	Estimate Update	Status: E

Shipping Hold
 Interface Hold
 Estimate Sent
 Parts Received
 Passed Inspection
 Return as Received
 Has Been Approved
 Internal Repair
 Exclude TATC

Current Status
 Closed
 1/27/2001 9:48:24 AM
 travisbw
 Repair Bench
 Repair Location
 ILN
 Current Location
 ILN
 Transfer Number

Repair Search Refresh Close

naqlct1 - ILN/Prod frmRepairMain NAGLETTJ Monday, Dec 13 2010 10:14 AM

start frmRepairMain - FGI 6 Microsoft Office E... NBC-WKTV News Cha... 11 Microsoft Office...

RECEIVED
 DEC 17 2010

BY:

November 30, 1970

Remington Arms
14 Hoester Avenue
Ellicott, N.Y. 13357

5395

22"
BT 1/70
2#

Dear Madam or Sir,

Enclosed is my rifle for inspection as there was an accidental discharge of my rifle on the opening day of deer hunting. It discharged while closing the bolt on a cartridge in the chamber. It was a warm morning so my hands were bare and after recalling several times my actions as I closed the bolt, I am quite sure nothing touched the trigger.

I was a close recipient of a bullet from a 700 about thirty eight years ago in Utah when one of my hunting partners was unloading at the campfire but because of the smoke he shot out one of the tires on the jeep instead of my knee cap.

I've read about the problems with this model gun more than once and was skeptical that it was a problem with the gun. No more!

Please advise, I would no longer sell
or pass this gun along to a family
member in it's current condition and
probably wouldn't use it again myself.

Please contact me when the inspection
is completed, Phone - 651-433-2737.
Email - tom.vogel@yahoo.com.

Address: Thomas Vogel
21621 Oldfield Ave. N.,
Scandia, MN. 55073


Thank You,

Thomas Vogel

Serial
Number:

6297222

Model: 700

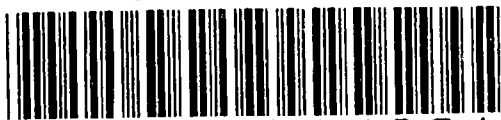

RE00214001

could not duplicate concerns.
TA, set screws altered. Replace
TPA, check test fire under
BLP Con # 20.00 + ship



